



ENGINEERING CONSULTING SERVICES
VOLUME 6 - APPENDIX
SECTION 6.25 – WEMINDJI ACCESS ROAD
Feasibility Study Final Report Phase I



Consultant Reference: LGA-1-GN-F-FRN-RT-0006_01_Section6.25



Stantec ■ DESFOR ■ SYSTRA

with subconsultant





La Grande Alliance

Feasibility Study Phase I

Feasibility study of Maquatua River crossing bridge - Wemindji.

2023/03/31



VEI Document Number: LGA-1-GN-T-TGN-RT-0006_00_6.25



Stantec ■ DESFOR ■ SYSTRA

Contributors

GENERAL INFORMATION

Version	01	02
Date	2023/03/31	2023/03/30
Prepared by	DZ	DZ
Reviewed by	SB	SB
Approved by	SB	AC
Comments	Draft for comments	Final version

Prepared by:




Daniel Zaccari, eng.
Bridge Engineer #5014563

Reviewed by:


2023-04-03

Sylvain Bédard, eng.
Bridge Engineer #121332

Approved by:

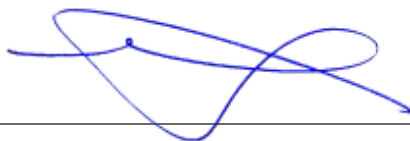

Alessandro Cirella, eng
Project Director, VEI
Project director



Document IDENTIFICATION

La Grande Alliance Feasibility Study Phase I

Feasibility study of
Maquatua River crossing
bridge - Wemindji.

Document Reference:
LGA-1-GN-T-TGN-RT-0006_00_6.25

Table of Contents

1. MANDATE AND INTRODUCTION.....	5
1.1 SCOPE OF STUDY.....	5
1.2 OUT OF SCOPE	5
1.3 INTRODUCTION	5
2. INPUT DATA AND HYPOTHESIS.....	6
2.1 INPUT DATA.....	6
2.1.1 REFERENCES	6
2.1.2 DOCUMENTS	6
2.2 EXISTING CONDITION	6
2.3 MISSING DATA AND HYPOTHESIS	7
2.3.1 MISSING DATA	7
2.3.2 HYPOTHESIS TO BE VALIDATED	8
2.3.3 DIFFERENCES BETWEEN STANDARDS/EXISTING STRUCTURE	8
3. CALCULATION HYPOTHESIS	9
3.1 MATERIALS	9
3.1.1 WOOD STRUCTURE	9
3.1.2 STEEL BEAM	9
3.2 BRIDGE AND LOAD DESCRIPTION	9
3.2.1 BRIDGE DESCRIPTION.....	9
3.2.2 TRUCK LOAD.....	10
3.2.3 DISTRIBUTION FACTOR.....	10
4. VERIFICATION OF THE EXISTING BRIDGE	11
4.1 ANALYSIS RESULTS.....	11
4.2 INPUT DATA.....	11
4.2.1 GENERAL PROPERTIES	11
4.2.2 CHARACTERISTIC OF THE DECK	12
4.2.3 VUE EN COUPE DU MODÈLE ÉTUDIÉ.....	12
4.2.4 CONCLUSION OF ANALYSIS	13
5. WIDENING SOLUTIONS	13
5.1 SOLUTION N°1 – WIDENING OF THE STRUCTURE TO 6.706 M ROAD WIDTH	13
5.1.1 CROSS SECTION STUDIED	13
5.1.2 MODIFICATIONS BETWEEN THE EXISTING BRIDGE AND THE PLANNED BRIDGE.....	14

5.1.3	CONCLUSION OF ANALYSIS	14
5.1.4	CONSEQUENCES ON CONCRETE ABUTMENT.....	15
5.2	SOLUTION N°2 - WIDENING OF THE STRUCTURE TO 8,206 M ROAD WIDTH.....	16
5.2.1	CROSS SECTION STUDIED	17
5.2.2	MODIFICATIONS BETWEEN THE EXISTING BRIDGE AND THE PLANNED BRIDGE.....	17
5.2.3	CONCLUSION OF ANALYSIS	17
5.2.4	CONSEQUENCES ON SUPPORTS	18
5.3	SOLUTION N°3 - WIDENING OF THE STRUCTURE TO 8.206 M.....	19
5.3.1	CROSS SECTION STUDIED	19
5.3.2	MODIFICATIONS BETWEEN THE EXISTING BRIDGE AND THE PLANNED BRIDGE.....	19
5.3.3	SIZING.....	20
5.3.4	CONSEQUENCES ON SUPPORTS	20
5.4	SOLUTION N°4 - WIDENING OF THE STRUCTURE TO 8.206 M.....	21
5.4.1	CROSS SECTION STUDIED	21
5.4.2	MODIFICATIONS BETWEEN THE EXISTING BRIDGE AND THE PLANNED BRIDGE.....	21
5.4.3	SIZING.....	21
5.4.4	CONSEQUENCES ON SUPPORTS	22
5.4.5	REASONS OF ELIMINATION	22
6.	ADDITIONAL DEMAND.....	22
6.1	CONCRETE SLAB ON EXISTING BEAMS	22
6.2	NEW BRIDGE	23
7.	ESTIMATION OF SOLUTIONS.....	23
8.	SYNTHESIS TABLE AND RECOMMENDATIONS	26
8.1	SYNTHESIS TABLE.....	26
8.2	RECOMMENDATION	27
	APPENDIX – INSPECTION REPORT WEMINDJI	28

List of Tables

Figure 2-1 : Cross Section.....	6
Figure 2-2: Elevation view.....	7
Figure 2-3 : Plan view	7
Figure 3-1 : type of road	10
Figure 3-2 : Type of additional charges	10
Figure 4-1 : Cross section	12
Figure 4-2 : Conclusion of SAFI.....	13
Figure 5-1 : cross section	14
Figure 5-2 : Conclusion	14
Figure 5-3 : Concrete abutment.....	15
Figure 5-4 : Details.....	16
Figure 5-5 : Cross section	17
Figure 5-6 : Conclusion of SAFI.....	17
Figure 5-7 : Abutment widening	18
Figure 5-8 : Pier cap widening details.....	19
Figure 5-9 : cross section	19
Figure 5-10 : cross section	21
Figure 6-1 : Bowstring.....	23

List *of* Tables

Table 7-1 : Estimation Solution no.1	24
Table 7-2 : Estimation Solution no.2	25
Table 7-3 : Estimation Solution no.3	26

1. MANDATE AND INTRODUCTION

1.1 SCOPE OF STUDY

The contract consists of a feasibility study to widen the bridge at km 4 on the road of Wemindji crossing the Maquatua River.

The content of the report is as follows:

1. Preliminary studies of the following three options (with the same road axis) :
 - a. Symmetric widening of the bridge,
 - b. One side widening of the bridge,
 - c. Demolition/reconstruction.
2. Analysis of the impact of the bridge widening on approaches,
3. Summary table of solutions studied,
4. Estimation (structure side).

1.2 OUT OF SCOPE

The scope of the report does not include the study of the creation of an independent pedestrian bridge. The pedestrian way will be considered to cross the bridge on an enlarge roadway or on a path isolated from the vehicles by a barrier or sidewalk.

1.3 INTRODUCTION

This report aims to:

- Present the data and list the assumptions used,
- Evaluate the current dimensioning of the structure to evaluate the possibilities of changing the deck width by conserving existing structural elements,
- Submit widening solution and provide, for each solution:
 - The preliminary design of the wood decking,
 - The preliminary design of the wood sleepers,
 - The preliminary design of the steel beams,
- We are using the Safi software “Pont acier-bois v14.0.3” as well as Excel software for manual checking.

2. INPUT DATA AND HYPOTHESIS

2.1 INPUT DATA

2.1.1 References

- [1] « Handbook of steel construction » – ninth edition 2004,
- [2] CAN/CSA – S6 : 19 Canadian Highway Bridge Design Code,
- [3] Manuel de conception des structures, MTQ December 2021
- [4] Formulaire de rdm des techniques de l'ingénieur.
- [5] Software SAFI v14.0.3,

2.1.2 Documents

- [6] 776872_offre_CNG_study_bridge_Wemindji,
- [7] Study 152700393_200-110-PO-R-0001-0 « Damage survey of the access road bridge over Maquatua river in Wemindji »,

2.2 EXISTING CONDITION

The existing conditions have been surveyed on the site by the inspection team. Refer to report 152700393_200-110-PO-R-0001-0 for additional information regarding field conditions including number and location of braces.

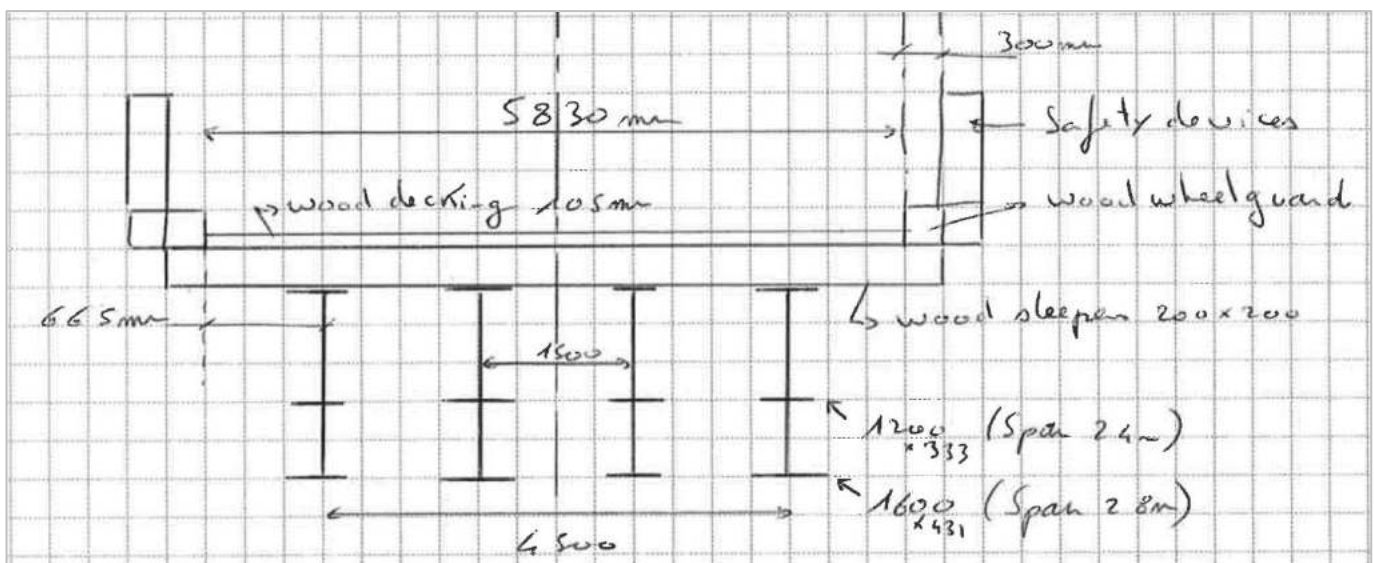


Figure 2-1 : Cross Section

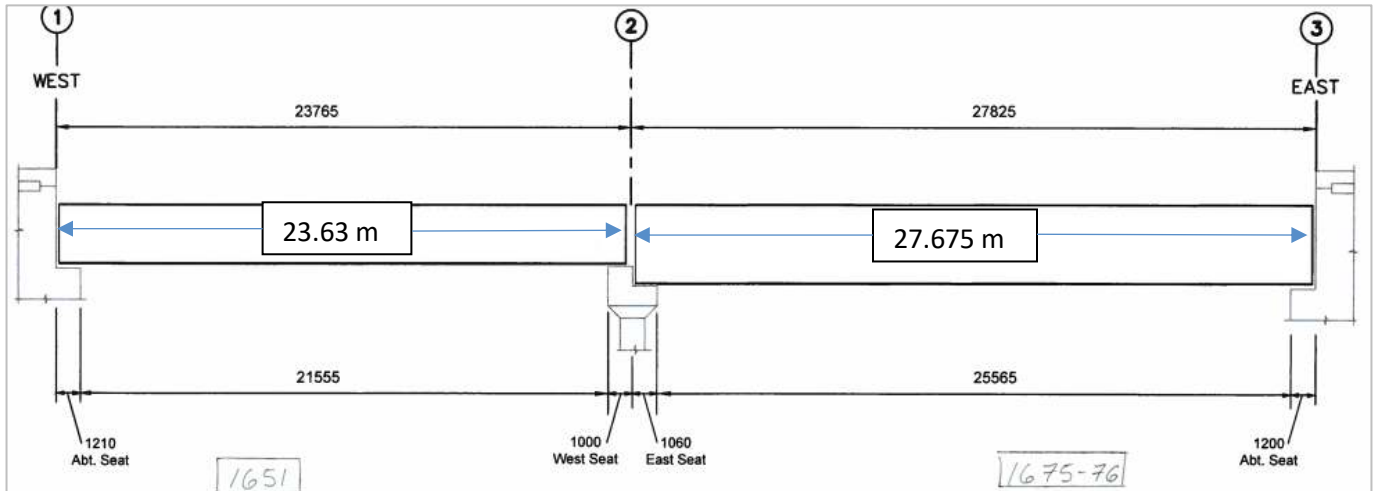


Figure 2-2: Elevation view

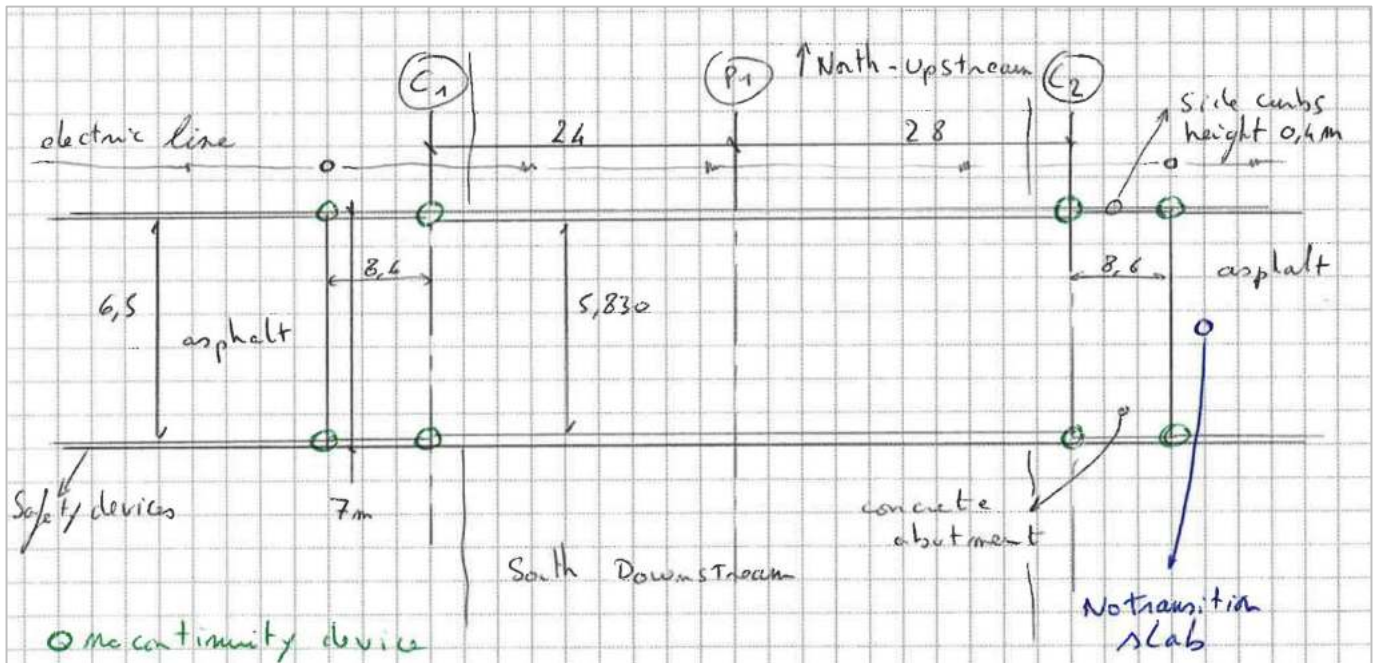


Figure 2-3 : Plan view

2.3 MISSING DATA AND HYPOTHESIS

2.3.1 Missing data

The following information was not available prior to this study :

- Dimensions of steel beams : thickness of webs and lower and upper flange of the 1600 steel beam; width of the lower flange of the 1600 steel beam,

- Geotechnical report,
- Drawings of the current bridge and site reports of the current bridge,
- Dimensions and type of bearing mechanism,
- Presence of transition slabs behind concrete abutments.

2.3.2 Hypothesis to be validated

We took those hypothesis in the study :

- Material properties :
 - Wood elements : see section 3.1.1,
 - Steel elements : see section 3.1.2
- Dimensions of the steel beams: (grade G40.21 350AT)
 - For 28 m span : 4 steel beams WWF 1600 x 431,
 - For 24 m span : 4 steel beams WWF 1200 x 333.

We assume that the beams of the structure are made of weathering steel. We also note that the vehicles circulate directly on the concrete slabs of the abutments (without any bituminous overlay). We therefore recommend not to use de-icing salt on the structure and its approaches to prevent premature deterioration of the beams and abutments.

2.3.3 Differences between Standards/Existing structure

The usable width of the structure is 5.83 m instead of 6.706 m for a MTQ standard two-way steel-wood structure. We notice a difference of 876 mm. According to MTQ standards, a structure with a usable width of 5.83 m is a one-road structure only.

The width of the road outside of the structure is about 6.5 m plus shoulders and, therefore, seems to correspond to a type D road, i.e. two lanes of 3.3 m with 2x1 m gravel shoulders. Therefore, we note a significant narrowing of the roadway, especially if two heavy vehicles arrive at the bridge at the same time or for potential pedestrians crossing the bridge while a vehicle comes across.

The barrier on the bridge and its approaches are not up to standard. There is no continuity between the guard rail along the road and the concrete barrier on the bridge abutments. Also, there is no continuity between the concrete barrier and the wood barrier on the bridge.

Currently, none of the barriers near the structure provide adequate safety for users. In the event of an accident, the owner may be deemed responsible if the barrier systems do not comply with the code requirements (lack of continuity) and is likely to face legal proceedings.

It seems there is no transition slab between concrete abutments and the road. In time, a sag of the approach embankment, or a deterioration of the abutment's concrete may occur.

In the event of an accident on the structure, the barrier must protect the users. Consequently, the barriers must have a minimum height of 0.9 m for vehicles and can go up to 1.10 m when pedestrians are allowed on the structure

and 1.40 m for bicycles. However, the concrete curbs on the abutments have a height of less than 40 cm. These systems will have to be raised to ensure the safety of the users according to the vocation of the structure.

As for damages observed on the site, permanent deformations of the guard rail outside the structure have been noted (see doc ref [7]). An oblique cracking, which begins in the corner of the stair step in the southern part of the structure have also been noted on the pier cap. The crack is less than 0.8 mm wide (see doc ref [7]).

Accumulation of rubble near the abutment and pier bases are present. Regular cleaning of the structure shall be performed.

We do not observe any notable deterioration linked to the corrosion of the steel beams. However, we recommend repainting the upper flanges of the structure during the installation of the new wooden deck to ensure its protection and durability.

We do not see any cracking or delamination of the concrete that would suggest carbonation deterioration.

We will not recommend correction of the concrete related to the carbonation of it.

3. CALCULATION HYPOTHESIS

3.1 MATERIALS

3.1.1 Wood structure

Wood structures : wood decking, wood sleepers, wheel guard and safety devices. All these elements would be in “SPF” quality n°1

Wood : Spruce – Pine - Fir (SPF).

$F_{bu} = 9,6 \text{ MPa}$, $F_{vu} = 1,2 \text{ MPa}$, $F_{qu} = 3,6 \text{ MPa}$, $\rho = 0,612 \text{ t/m}^3$ et $E = 10 \text{ GPa}$

3.1.2 Steel beam

Span n°1 : 4 beams : WWF 1200 x 333, $F_y = 350 \text{ MPa}$ de classe W, $E = 200 \text{ GPa}$, $\rho = 7,85 \text{ t/m}^3$.

Span n°2 : 4 beams : WWF 1600 x 431, $F_y = 350 \text{ MPa}$ de classe W, $E = 200 \text{ GPa}$, $\rho = 7,85 \text{ t/m}^3$.

The coefficient of resistance of steel beams subjected to shear , cf chapter 10.5.7.b doc ref [2], is : $\Phi_s = 0,95$.

The resistance coefficient of steel beams subjected to bending, cf 10.5.7.a doc ref [2], is : $\Phi_s = 0,95$.

3.2 BRIDGE AND LOAD DESCRIPTION

3.2.1 Bridge description

Road class: C – this hypothesis remains to be validated; we will use a road class A in this document

Tableau 1.1
Classes de route
(voir l'article 1.4.2.2)

Classe de route	Débit journalier moyen (DJM) par voie (nombre de véhicules)	Débit journalier moyen de camions (DJMC) par voie (nombre de véhicules)
A	> 4000	> 1000
B	> 1000 à 4000	> 250 à 1000
C	100 à 1000	50 à 250
D	< 100	< 50

Figure 3-1 : type of road

Structure category : slender structure (table 5.2 doc ref [2]).

Structure type : wood decking on wood sleepers on steel beam, type C cf § 5.1 doc ref [2].

Road width on the bridge: $W_c = 6706$ mm (cf. tab 9.2.1 doc ref [3]).

The calculation width road is calculated according to chapter § 3.8.2 doc ref [2] and according to table 3.4 with $n = 2$: $W_e = W_c/n = 3,353$ m

Span : $L_{\text{span } n^{\circ}1} = 24$ m, $L_{\text{span } n^{\circ}2} = 28$ m.

Type of additional load : D2

14.8.2.1 General

Dead load shall include the weight of all components of the bridge, fill, utilities, and other materials permanently on the bridge. Dead loads shall be determined from available plans and verified with field measurements in accordance with Clause 14.6.

Dead load shall be apportioned to three categories, D1, D2, and D3, as follows:

- D1: dead load of factory-produced components and cast-in-place concrete, excluding decks;
- D2: cast-in-place concrete decks (including voided decks and cementitious concrete overlays), wood, field-measured bituminous surfacing, and non-structural components; and
- D3: bituminous surfacing where the nominal thickness is assumed to be 90 mm for the evaluation.

Figure 3-2 : Type of additional charges

3.2.2 Truck load

We consider the CL-625 (as defined in doc ref [2]) as the road overload. The dynamic increase coefficient is determined according to tables 3.2.4 and 3.2.5 of chapter § 3.2.2.2 doc ref [3] : CMD shear force = 0,25 and CMD bending moment = 0,25.

3.2.3 Distribution factor

We calculate the distribution factors in accordance with table 5.2 of chapter § 5.7.1.1 doc ref [2].

3.2.3.1 Longitudinal vertical shear

We calculate the shear distribution factor in accordance with the chapter § 5.7.1.4 doc ref [2], with :

- S, the spacing of the beams : 1,50 m
- n number of lanes : 2
- RL, the modifying factor cf. § 3.8.4.2 doc ref [2] : 0,9
- F, the width which characterizes the distribution of the load for a bridge cf. tab 5.7 of § 5.7.1.4.1.2 doc ref [2] : 4,60 m

$$Vg/V_T = \frac{S \cdot n \cdot R_L}{F} = \frac{1,50 \times 2 \times 0,9}{4,6} = 0,587 = fec$$

3.2.3.2 Bending moment

We calculate the axle factor in accordance with chapter § 5.7.1.2 doc ref [2], with :

- With F, according to table 5.3 of § 5.7.1.2.1.2 doc ref [2] : 4,60 m.
- With Cf, the correcting factor of tab 5.3 of chapter § 5.7.1.2.1.2 doc ref [2] : 0.

$$Mg/M_T = \frac{S \cdot n \cdot R_L}{F \cdot \left[1 + \frac{\mu \cdot Cf}{100}\right]} = \frac{1,50 \times 2 \times 0,9}{4,6 \left[1 + \frac{\mu \times 0}{100}\right]} = 0,587 = fem$$

4. VERIFICATION OF THE EXISTING BRIDGE

Preliminary checks show that the girders of the 28 m span have a greater reserve capacity than the girders of the 24 m span. Consequently, we will only check, via the Safi software, the beams of the 24 m span.

4.1 ANALYSIS RESULTS

The software “SAFI Pont Acier-Bois v14.0.3” was used to check the capacity of the existing bridge.

The following show the input data of the software as well as the main results obtained.

4.2 INPUT DATA

Design of wood bridge : Code: CAN-CSA/S6-19

4.2.1 General properties

Mode of work : MTQ

Design Truck : CL1-625A

Road class : A

Number of roads :	1
Clear span :	24000 mm
Number of steel beams :	4
Road width usable by vehicles :	5830 mm
Barrier weight :	0.650 kN/m
Side supports :	L76x76x9.5
Spacing c/c of side supports :	3600 mm
Deflection criteria :	L/275
Load use for deflection :	0.9*truck*(1+CMD), distribution factor includes the "0.9" effect

4.2.2 Characteristic of the deck

width of wood sleepers :	200 mm	
Thickness of wood sleepers :	200 mm	
Spacing c/c between wood sleepers :	200 mm	
Overlapping of wood sleepers :	No overlap	
Thickness of decking :	105 mm	
Wood : Spruce– Pine - Fir. (Quality No. 1)		
Fbu = 9.6 MPa	Fvu = 1.2 MPa	Fqu = 3.6 MPa

4.2.3 Vue en coupe du modèle étudié

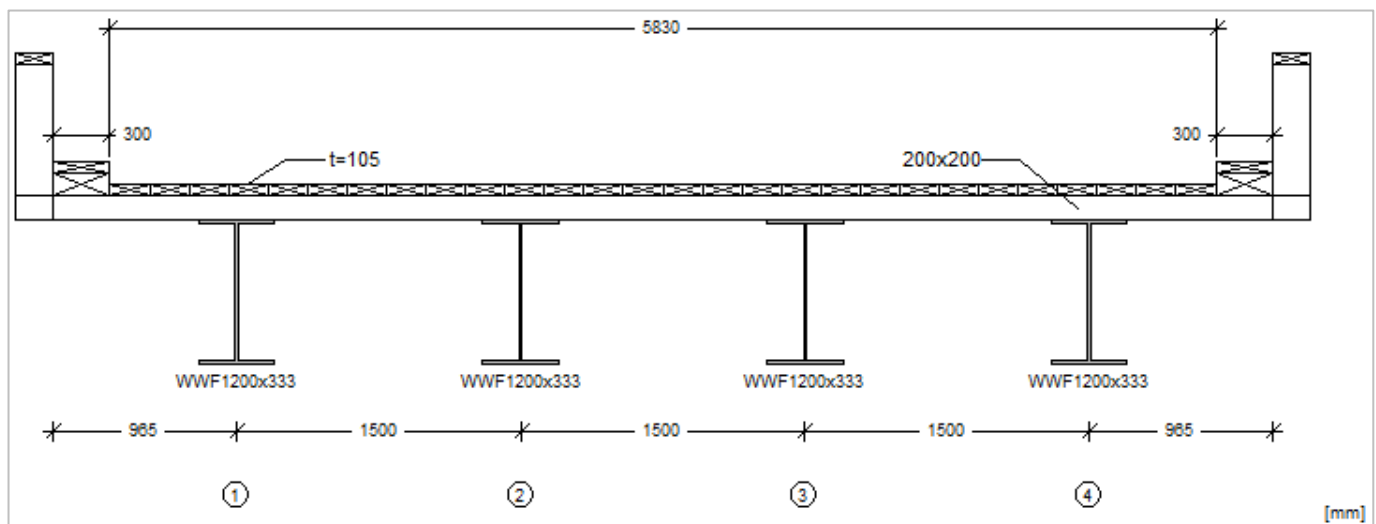


Figure 4-1 : Cross section

4.2.4 Conclusion of analysis

Facteurs de capacité de surcharge (F)							
Poutres d'acier				Traverses de bois			
0 4	CL1-625	CL2-625	CL3-625	0 4	CL1-625	CL2-625	CL3-625
Flexion	2.53	2.55	3.14	Flexion	1.20	1.20	1.20
Cisaillement	5.98	6.70	8.55	Cisaillement	2.02	2.02	2.02
Flèche	2.86	3.07	4.10	Écrasement	3.14	3.14	3.14
Capacité	161.0 t	123.7 t	96.0 t	Capacité	76.8 t	58.3 t	36.8 t

Affichage recommandé: D-200, D-200-P

Figure 4-2 : Conclusion of SAFI

The overload capacity factors obtained from the Safi software indicate that the current bridge, considering a single traffic lane, has sufficient resistance to support the design load without modification.

It is recommended to install a D-200 display panel indicating a one lane passage restriction, the current width being insufficient to allow 2 lanes on the bridge.

5. WIDENING SOLUTIONS

5.1 SOLUTION N°1 – WIDENING OF THE STRUCTURE TO 6.706 M ROAD WIDTH

We check the possibility of widening the structure so that it meets the standards for a two-lane structure, while keeping the existing steel beams without modifying their position.

5.1.1 Cross section studied

The software does not allow us to make a model at 6.706 m with cantilevers greater than 1.20 m (sleepers usually can't support a longer cantilever). We have therefore modified the cross-section in order to tend towards a useful width of 6.706 m; For purpose of sizing and calculation verification, we retained a width usable by vehicles of 6.500 m and curb of 0.2 m.

We present the cross section of the solution n°1

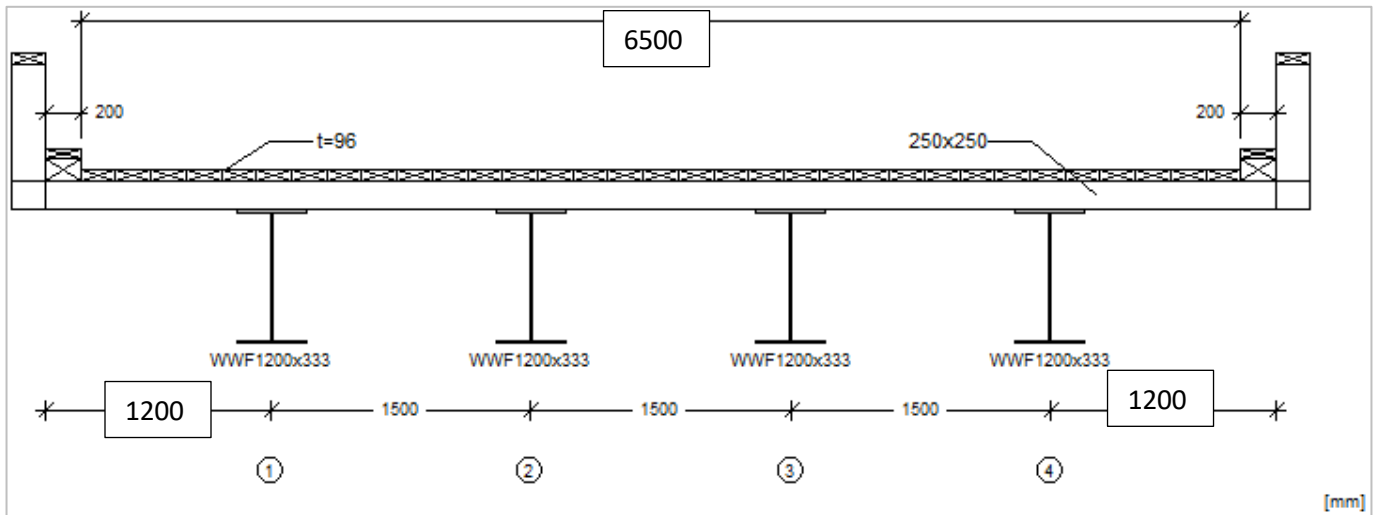


Figure 5-1 : cross section

5.1.2 Modifications between the existing bridge and the planned bridge

Below, we list modifications between the existing bridge and the planned bridge of solution n°1.

	Proposed deck	Existing deck
• usable width:	6.500 m	5.830 m,
• curb :	0.2 x 0.2	0.3 x 0.3,
• wood decking :	96 mm	105 mm,
• Wood sleepers :	250 x 250	200 x 200.

5.1.3 Conclusion of analysis

Facteurs de capacité de surcharge (F)							
Poutres d'acier				Traverses de bois			
0 4	CL1-625	CL2-625	CL3-625	0 4	CL1-625	CL2-625	CL3-625
Flexion	2.45	2.48	3.04	Flexion	1.21	1.21	1.21
Cisaillement	6.37	7.15	9.11	Cisaillement	2.24	2.24	2.24
Flèche	2.10	2.25	3.01	Écrasement	3.08	3.08	3.08
Capacité	156.1 t	120.0 t	93.1 t	Capacité	77.3 t	58.8 t	37.1 t

Figure 5-2 : Conclusion

5.1.4 Consequences on concrete abutment

The widening of the structure requires a widening of the usable width on the abutment and therefore the removal of the concrete side curbs on the abutment.

The widening can be carried out using lateral corbels, as shown in the diagram below.

Keeping the beam centre lines has the advantage of minimizing the work on the supports with possible widening of piers and abutments.

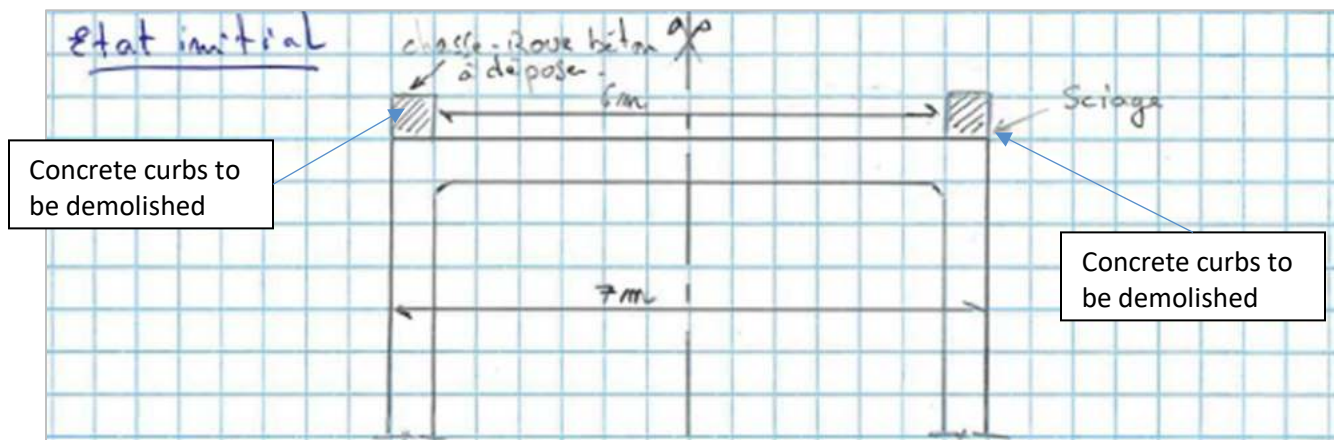


Figure 5-3 : Concrete abutment

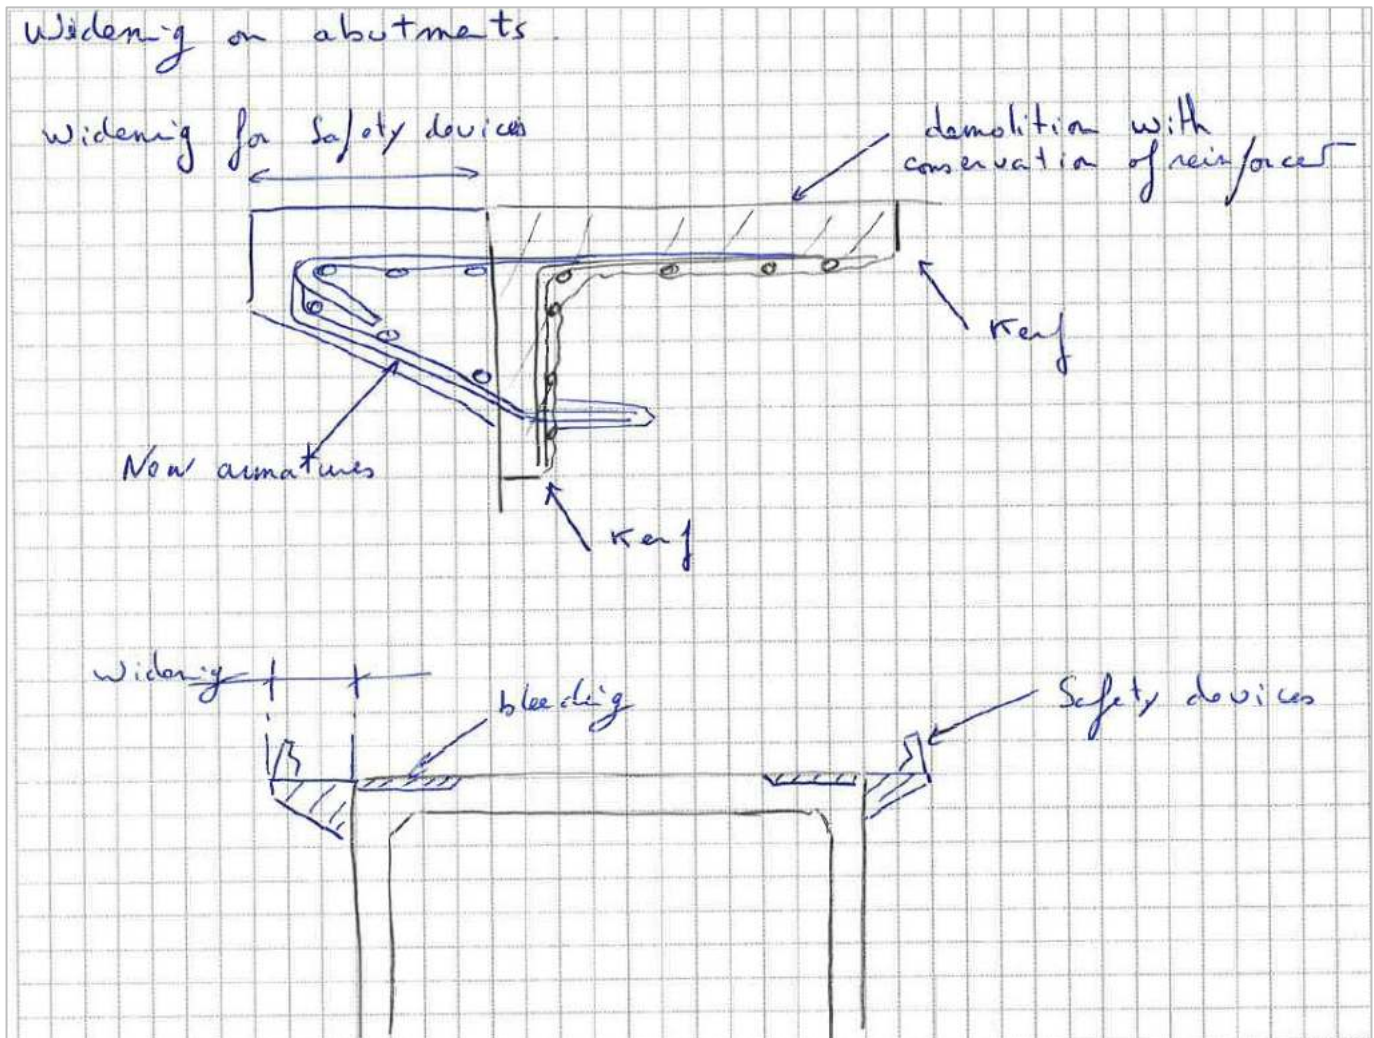


Figure 5-4 : Details

Required Work on abutments :

- The relocation of the curbs,
- Widening of the running surface according to the widening of the roadway on the structure,
- Anchorage of the reinforcement of the widening in the abutment,
- Construction of barriers on the edges of abutments with the implementation of overlapping systems to bring the safety devices into conformity on and off the structure.

5.2 SOLUTION N°2 - WIDENING OF THE STRUCTURE TO 8,206 M ROAD WIDTH

In addition to the widening of the structure to 6.706, in order to comply with the minimum standards for double road structures, we are considering the possibility of carrying out an additional widening by adding two service tracks of 0.75 m wide to give more space for pedestrians.

This widening leads to a width of 8,206 m usable by vehicles and pedestrians on the structure.

5.2.1 Cross section studied

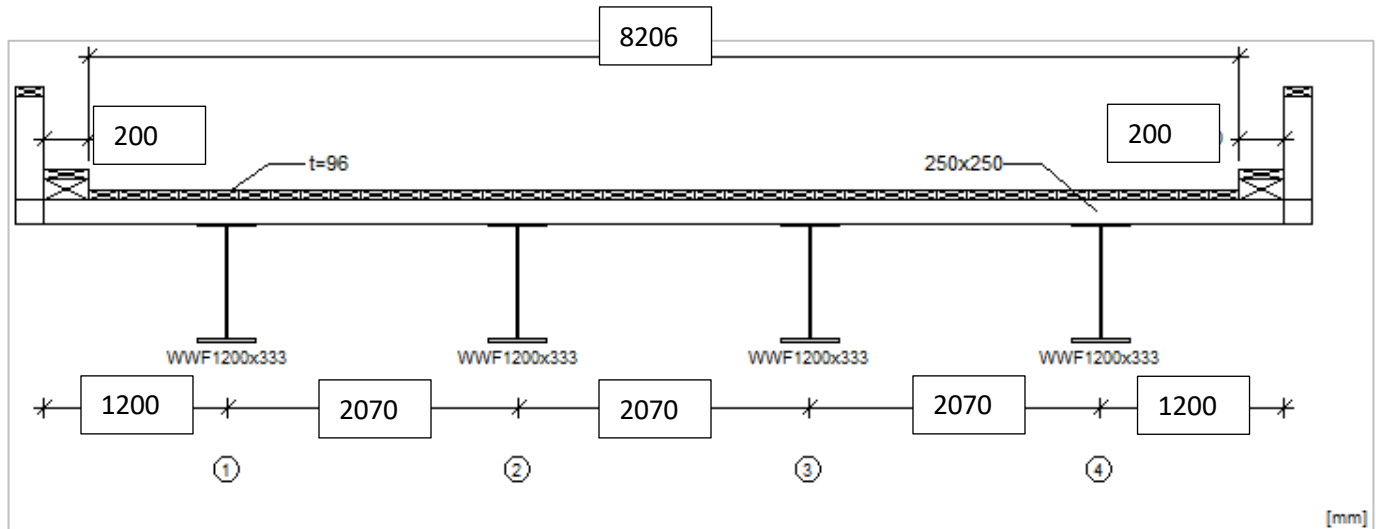


Figure 5-5 : Cross section

5.2.2 Modifications between the existing bridge and the planned bridge

Below, we list modifications between the existing bridge and the proposed bridge for solution n°2 :

	Proposed deck	Existing deck
• usable width:	8.206 m	5.830 m,
• curb :	0.2 x 0.2	0.3 x 0.3,
• wood decking :	96 mm	105 mm,
• wood sleepers :	250 x 250	200 x 200,
• Spacing between steel beams :	2.07 m	1.50 m.

5.2.3 Conclusion of analysis

Facteurs de capacité de surcharge (F)							
Poutres d'acier				Traverses de bois			
0 4	CL1-625	CL2-625	CL3-625	0 4	CL1-625	CL2-625	CL3-625
Flexion	2.12	2.14	2.63	Flexion	1.21	1.21	1.21
Cisaillement	5.54	6.21	7.91	Cisaillement	2.30	2.30	2.30
Flèche	2.14	2.30	3.07	Écrasement	3.02	3.02	3.02
Capacité	134.9 t	103.7 t	80.4 t	Capacité	77.3 t	58.8 t	37.1 t

Figure 5-6 : Conclusion of SAFI

According to the result, the load capacity is governed by the capacity of the sleepers.

5.2.4 Consequences on supports

5.2.4.1 Abutment widening

Abutments are 7 m wide overall.

The widening of the roadway to 8,206 m entails :

- Removal curbs and widening of the roadway similar to solution no.1;
- Removal of existing seats bloc and construction of new ones;
- Widening of the abutments using reinforced concrete corbel as show below.

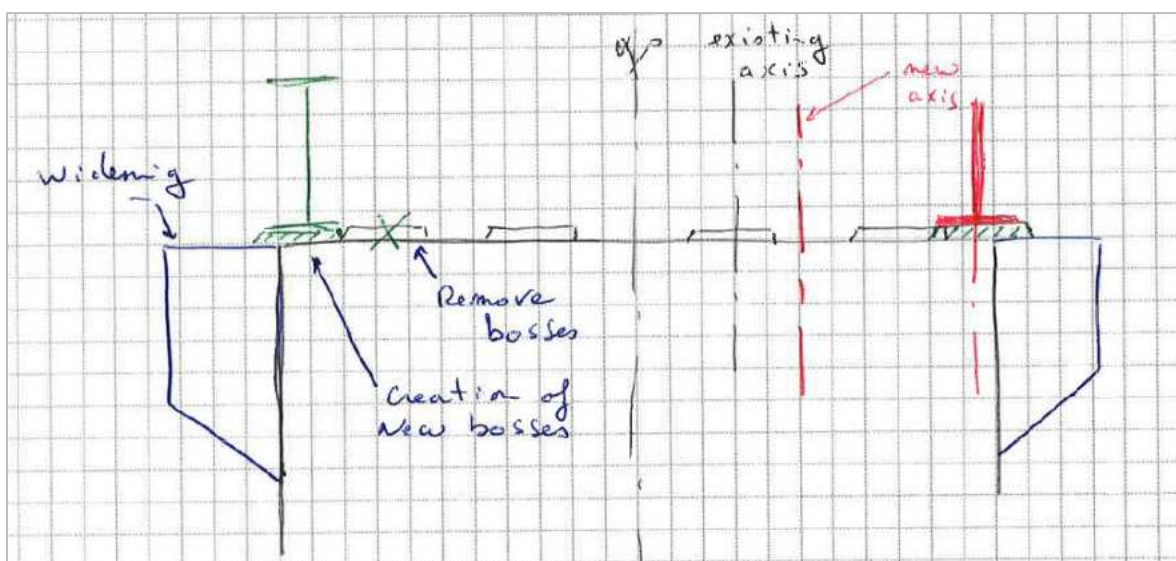


Figure 5-7 : Abutment widening

5.2.4.2 Widening of the pier

The increase in the spacing between the steel beams implies a widening of the pier cap.

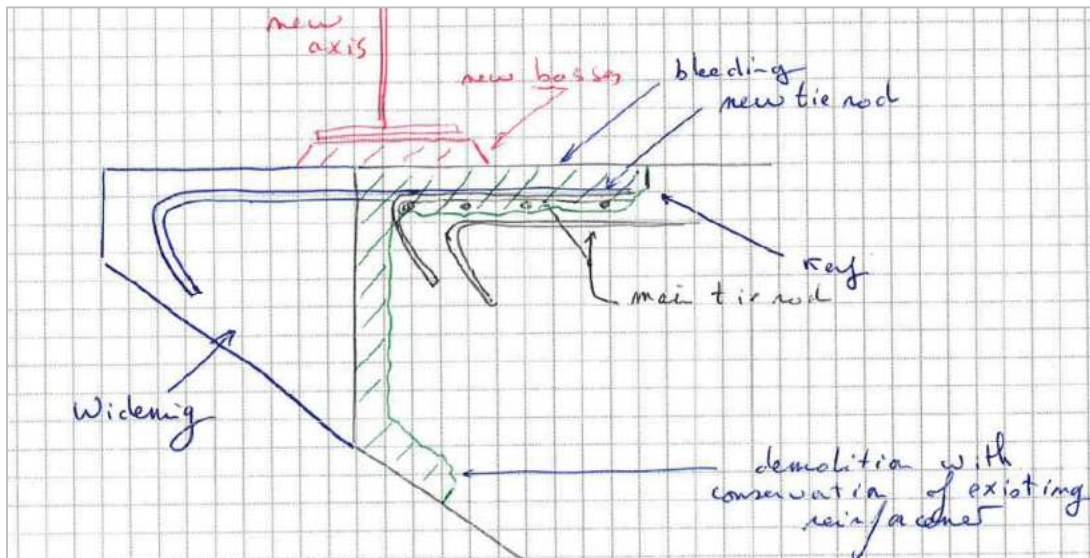


Figure 5-8 : Pier cap widening details

5.3 SOLUTION N°3 - WIDENING OF THE STRUCTURE TO 8.206 M

5.3.1 Cross section studied

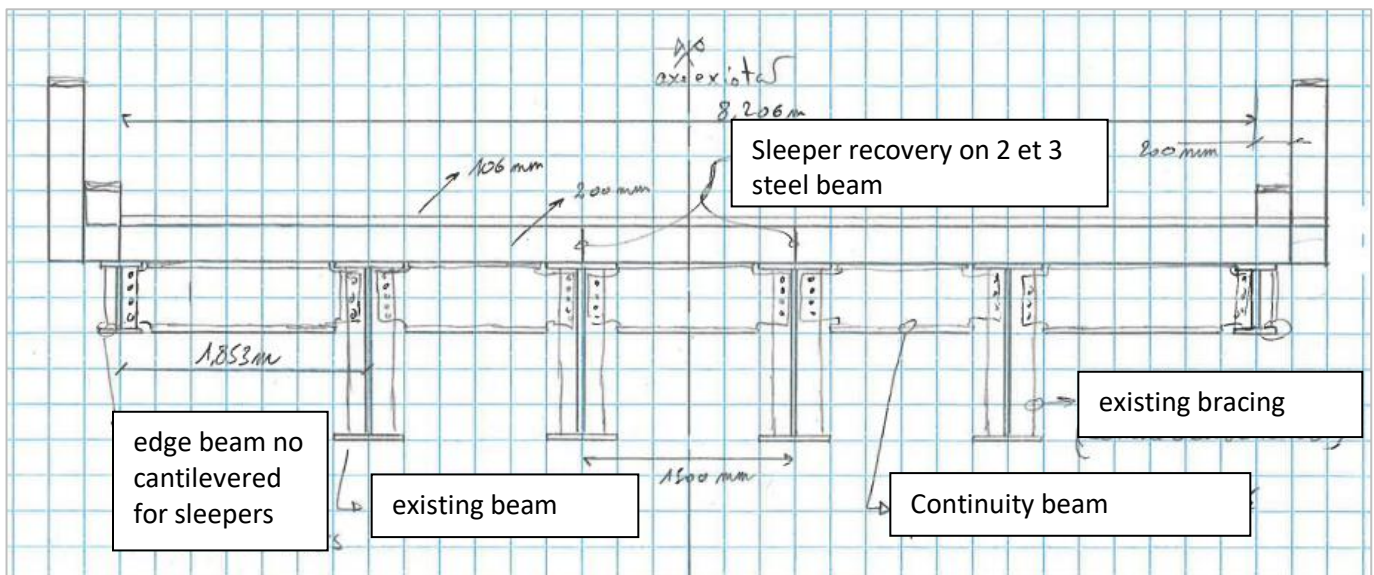


Figure 5-9 : cross section

5.3.2 Modifications between the existing bridge and the planned bridge

This solution is similar to the previous one, but there is no need to relocate the girders. Since the sleepers are the limiting elements, we add a support beam at the edge to limit the sleeper's span. Below, we list modifications between the existing bridge and the proposed bridge solution n°3 :

	Proposed deck	Existing deck
• usable width :	8.206 m	5.830 m,
• Curb :	0.2 x 0.2	0.3 x 0.3,
• Bracing :	a continuity beam will be added in order to distribute the loads of the edge beams to the existing beams.	
• Overhang :	edge beam	1 m.

5.3.3 Sizing

The dimensioning of this solution requires a sophisticated model which will be produced in the preliminary design phase. We did a predesign of the side beam for estimation purpose.

Validation of the various previous solutions demonstrate the ability of the existing main beams to take up loads brought by this arrangement.

5.3.4 Consequences on supports

The vertical loads will be greater on the widened structure, it is therefore possible that it will be necessary to rework the seat blocks in order to avoid cracking of the existing ones.

The upper part of abutments is to be widened similar to solution no.1.

5.4 SOLUTION N°4 - WIDENING OF THE STRUCTURE TO 8.206 M

5.4.1 Cross section studied

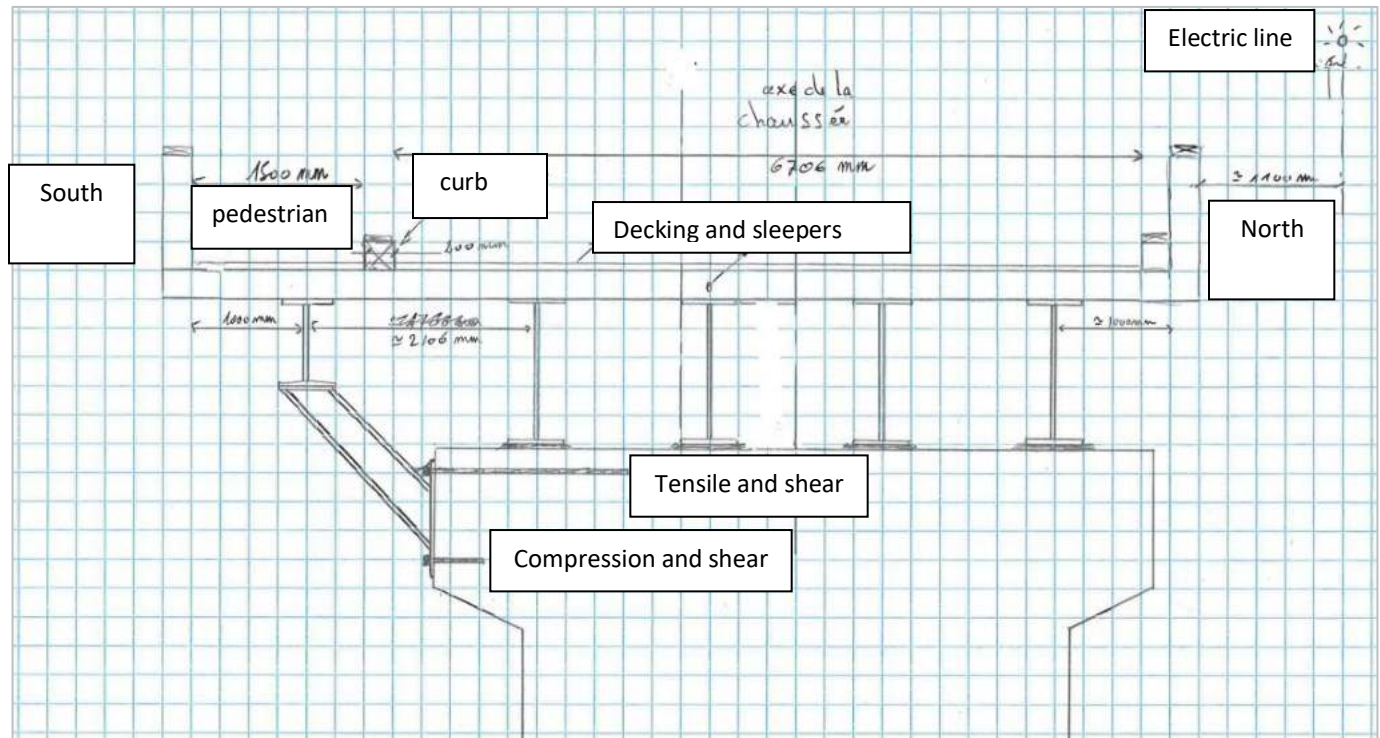


Figure 5-10 : cross section

The same principle of fixing the additional side beam will be considered on abutments.

5.4.2 Modifications between the existing bridge and the planned bridge

The road way will be widened to 6,706 m to accommodate 2 lanes of traffic, and a sidewalk will be added on one side of the structure for pedestrians. Below, we list modifications between the existing bridge and the proposed bridge for solution n°4 :

	Proposed deck	Existing deck
• usable width by vehicles :	6.706 m	5.830 m,
• usable width by pedestrians :	1,5 m	
• curb :	0.2 x 0.2	0.3 x 0.3,
• number of beams :	5	4

5.4.3 Sizing

If a barrier is installed between the road way and the sidewalk, the new edge beam can be smaller since the load on the sidewalk will be limited to pedestrians. Girders similar to the existing one can also be used for visual aspect

of the bridge. But if there is no barrier, it means trucks can go on the side and the edge beam will need to be the same size as the others.

Validation of the various previous solutions demonstrate the ability of existing main beams to take up loads brought by this arrangement.

5.4.4 Consequences on supports

The removal of the concrete curbs from the abutments is still necessary even in the non-widened area.

The pier cap will not need to be widened with concrete. However the verification of the pier stability will still be necessary.

Anchor rods will be made in the pier cap as well as in front walls of abutments. In order to avoid the main reinforcements of concrete structures, it will be necessary to locate the existing reinforcement and adjust the positioning of tie rods.

5.4.5 Reasons of elimination

Solution no.4 was not retained as a viable solution. This solution consists of channelling all pedestrian traffic on one side of the structure and separating it from the roadway in order to increase pedestrian safety.

As far as we are concerned, this arrangement does not seem to be suitable for the development of the site, which does not present any differentiated pedestrian traffic from the Wemindji road path. This solution should be considered as part of a larger development in which a pedestrian path would pass through the structure. Furthermore, the solution with braces anchored in concrete structures is not very esthetic.

6. ADDITIONAL DEMAND

6.1 CONCRETE SLAB ON EXISTING BEAMS

The solution of replacing the wooden deck with a concrete slab has been considered without adding an expansion joint over the pier between the two spans. Therefore, the bridge will become semi-continuous.

Beams for steel-wood structure have no initial camber, therefore the construction of a concrete slab with the addition of dowels can produce a permanent deflection of the steel beams. Even if the resistance of the beams is adequate, it can be troubling for the user to see the deflection and can also lead to drainage problems.

The addition of a 200 mm thick concrete slab will increase the load on the support of 500 kN for the 24 m span and 580 kN on the support of the 28 m span. The load of the steel beam and wood deck on the supports is currently 166 kN for the 24 m span, and 196 kN for the 28 m span.

The load capacity of the existing beams should be sufficient. Once in place, with the addition of shear stud on the beams, the concrete slab will take part in the support of the live load on the bridge.

It will be necessary in the subsequent phases of the project to check the stability and deflection of the steel beams during the pouring of the slab.

. Abutments and the pier are laid directly on the roc. Stability and bearing capacity will need to be checked with the new slab, but capacity of that type of foundation is usually of sufficient capacity.

With the addition of a concrete slab, the beams will need to be respaced at 2 m centre to centre to accommodate the new width.

6.2 NEW BRIDGE

To better suit any needs of the community, it is also an option the build an entirely new bridge. In this case, the new bridge can be as wide as needed to accommodate vehicles and pedestrians. It could also be a great opportunity to have a signature bridge near the community. An example of bowstring type bridge is shown below. It could be made of steel or laminated wood. However the more complex the structure become, the more the cost will increase accordingly.

In the case of the construction of a structure equipped with a concrete decking, it would be possible to requalify the current structure as a pedestrian structure and to build, alongside the existing structure, a new bridge which would take up user traffic. This solution would require the modification of the road alignment in order to make a connection on the new structure.

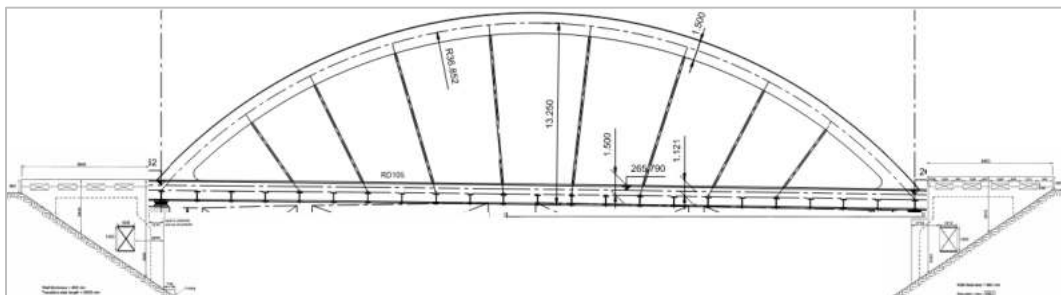


Figure 6-1 : Bowstring

7. ESTIMATION OF SOLUTIONS

In order to widen the existing bridge or to replace it, a temporary bridge and a diversion path will need to be built along the side of the existing one, or a detour, if one exists, will need to be put in place. In any case the cost for the work on the bridge does not include maintenance of service of the roadway during construction.

When needed, the work of demolition and reconstruction of seats blocks are included with the cost of the abutments head beam.

Table 7-1 : Estimation Solution no.1

Encryption		Designation	unity	Quantity	PUHT		%
Possibility n°1							
# 1	177 000	General prices					24,25%
	1	Mobilization and site organization	Lump		138 000	138 000	
	2	Demolition of existing bridge	Lump		39 000	39 000	
# 2	26 000	Earthworks and foundations					3,56%
	1	Excavations and filling	m3	300	40	12 000	
	3	Safety devices (type 1)	u	4	3500	14 000	
# 3	84 200	Abutment					11,53%
	1	Concrete (including grooves and formworks)	m3	21	2400	50 400	
	2	Reinforcement (including anchoring in existing)	kg	3100	8	24 800	
	3	Barriers	ml	36	250	9 000	
#4	259 600	Deck					35,56%
	1	Wood sleepers	m3	91	2000	182 000	
	2	Wood decking	m3	33	1800	59 400	
	3	Wheel guard	ml	52	100	5 200	
	4	Barriers	ml	52	250	13 000	
# 6	90 000	Various					12,33%
	1	Safety devices connection : bridge / abutment	unité	4	1500	6 000	
	2	Safety devices connection : abutment / road	unité	4	1000	4 000	
	3	Fill at approaches	m2	160	500	80 000	
	4	Wearing surface (approaches 15 m each side)	t	75	280	21 000	
# 7	72 000	Miscellaneous					9,86%
	1	Miscellaneous not detailed	Lump		72 000	72 000	
Cost per m ²	2470 \$/m ²				Total	730 000 \$	
Surface	370 m ²		contingency	25%	Total (cont)	912 500 \$	

Table 7-2 : Estimation Solution no.2

Encryption				unity	Quantity	PUHT		%
Possibility n°2		Designation						
# 1	255 000	General prices						24,24%
	1	Mobilization and site organization		Lump		199 000	199 000	
	2	Demolition of existing bridge		lump		56 000	56 000	
# 2	26 000	Earthworks and foundations						2,47%
	1	Excavations and filling		m3	300	40	12 000	
	2	Safety devices (type 1)		unit	4	3500	14 000	
# 3	122 000	Abutment and pier						11,60%
	1	Concrete (including grooves and formworks)		m3	31	2200	68 200	
	2	Reinforcement (including anchoring in existing)		kg	5600	8	44 800	
	3	Safety devices		ml	36	250	9 000	
	4	Concrete Abutment (including grooves and formwo		m3	2	2200	4 400	
	5	Reinforcement (including anchoring in existing)		kg	660	8	5 280	
	6	Head beam of abutments		m2	17	1200	20 400	
	7	Concrete pier (including grooves and formworks)		m3	2	2400	4 800	
	8	Reinforcement (including anchoring in existing)		kg	540	8	4 320	
	9	Head beam of the pier		m2	17	1200	20 400	
#4	388 645	Deck						36,94%
	1	Wood sleepers		m3	111	2000	222 000	
	2	Wood decking		m3	40	1800	72 000	
	3	Wheel guard		ml	52	100	5 200	
	4	Safety devices		ml	52	250	13 000	
	5	Painting of beams		m2	233	80	18 640	
	6	Bracings		kg	7226	8	57 805	
# 6	97 000	Various						9,22%
	1	Safety devices connection : bridge / abutment		unit	4	1500	6 000	
	2	Safety devices connection : abutment / road		unit	4	1000	4 000	
	3	Fill at approaches		m2	132	500	66 000	
	4	Wearing surface (approaches 15 m each side)		t	75	280	21 000	
# 7	104 000	Hazards						9,89%
	1	Hazards (including miscellaneous not detailed)		Lump		104 000	104 000	
Cost per m ²	2940 \$/m ²					Total	1 052 000 \$	
Surface	448 m ²			contingency	25%	Total (cont)	1 315 000 \$	

Table 7-3 : Estimation Solution no.3

Encryption		Designation	unity	Quantity	PUHT		%
Possibility n°3							
# 1	205 000	General prices					21,83%
	1	Mobilization and site organization	Lump		160 000	160 000	
	2	Demolition of existing bridge	Lump		45 000	45 000	
# 2	26 000	Earthworks and foundations					2,77%
	1	Excavations and filling	m3	300	40	12 000	
	2	Safety devices (type 1)	unit	4	3500	14 000	
# 3	122 000	Abutment					12,99%
	1	Concrete (including grooves and formworks)	m3	31	2200	68 200	
	2	Reinforcement (including anchoring in existing)	kg	5600	8	44 800	
	3	Safety devices	ml	36	250	9 000	
#4	393 160	Deck					41,87%
	1	Wood sleepers	m3	57	2000	114 000	
	2	Wood decking	m3	40	1800	72 000	
	3	Wheel guard	ml	52	100	5 200	
	4	Safety devices	ml	52	250	13 000	
	5	Painting of beams	m2	230	80	18 400	
	6	repartition beams	kg	6720	8	53 760	
	7	edge beams	kg	14600	8	116 800	
# 6	97 000	Various					10,33%
	1	Safety devices connection : bridge / abutment	unit	4	1500	6 000	
	2	Safety devices connection : abutment / road	unit	4	1000	4 000	
	3	Fill at approaches	m2	132	500	66 000	
	4	Wearing surface (approaches 15 m each side)	t	75	280,00 \$	21 000	
# 7	96 000	Miscellaneous					10,22%
	1	Miscellaneous not detailed	Lump		96 000	96 000	
Cost per m ²	2620 \$/m ²			round	Total HT	939 000 \$	
Surface	448 m ²			25%	Total TTC	1 173 750 \$	

8. SYNTHESIS TABLE AND RECOMMENDATIONS

8.1 SYNTHESIS TABLE

	Solution n°1	Solution n°2	Solution n°3
Usable width	6.706 m	8.206 m	6.706 m (trucks) 1,5 m pedestrian
Deck's surface	370 m ²	450 m ²	450 m ²
Curb	0.2 x 0.2 m	0.2 x 0.2 m	0.2 x 0.2 m
thickness of wood decking	96 mm	96 mm	105 mm
Straight sections of wood sleepers	250 x 250 mm	250 x 250 mm	197 x 203 mm
spacing between centre lines of steel beam	1.50 m	2.0 m	1.50 m
Bracing	unchanged	new	partially replaced

	Solution n°1	Solution n°2	Solution n°3
Number of steel beams	4	4	4 main girders and two edge beams
Length of the overhanging of wood sleepers	1.20 m	1.20 m	none
modification to the upper slab of abutments	Relocate barrier	Relocate barrier and widening the slab – more than 0,6 m	Relocate barrier and widening the slab – more than 0,6 m
Modification of abutments and pier width	unchanged	Yes widening abutment and relocation of seats blocks	unchanged
Barriers on bridge	conforming to standards	conforming to standards	conforming to standards
Barriers - approach	Not necessary	Yes – connection and widening of the roadway on the structure	Yes – connection and widening of the roadway on the structure
Safety of pedestrians	Improved like standards	Improved with increase of road way by 0,75 m per direction	Improved with increase of road way by 0,75 m per direction
Bearing mechanism	Unchanged - To be confirmed in preliminary design	Unchanged - To be confirmed in preliminary design	Unchanged - To be confirmed in preliminary design
Cost HT	912 500 \$ 2 470 \$/m ²	1 315 000 \$ 2 940 \$/m ²	1 173 000 \$ 2 620 \$/m ²

8.2 RECOMMENDATION

Wood Deck:

For the safety of the vehicles and pedestrians, we do recommend a large widening of the bridge deck, and we recommend solution no.2.

Solution no.1 is the least expensive but offer very few additional protections for the pedestrian. However, it is possible to increase security by building a dedicated footbridge alongside the existing bridge. This could be a viable solution. But the addition of a dedicated footbridge will bring the total price of the project around 1,2 M\$ in the same range as solutions no.2 and no.3.

Concrete Deck:

The weight of the concrete deck and the absence of knowledge on the existing one leads us to recommend the construction of a new bridge. In this case we recommend building a bridge with the road and pedestrians on the same bridge. We estimated the following for a complete bridge replacement

- Slab on a girder bridge : 6,25 M\$: 50 m long * 12,5 m width * 10°000 \$/m²,
- Signature bridge : 11,25 M\$: 50 * 12.5 * 18°000 \$/m²,

APPENDIX – INSPECTION REPORT WEMINDJI



CREE NATION GOVERNMENT

**DAMAGE SURVEY OF THE ACCESS ROAD
BRIDGE OVER MAQUATUA RIVER IN
WEMINDJI**

2019 DAMAGE SURVEY REPORT

Final version



Damage Survey of the Access Road Bridge Over Maquatua River in Wemindji

2019 Damage Survey Report,
Wemindji, QC Canada
Project #152700393

March 3, 2020

Prepared for:

The Cree Nation Government

Prepared by:

Stantec Consulting Ltd



O/Ref.: 152700393-200-110-PO-R-0001-0

Sign-off Sheet

This document entitled Wemindji Access Road Bridge Over the Maquatua River - 2019 Damage Survey was prepared by Stantec Consulting Ltd. ("Stantec") for the account of Cree Nation Government (the "Client"). Any reliance on this document by any third party is strictly prohibited. The material in it reflects Stantec's professional judgment in light of the scope, schedule and other limitations stated in the document and in the contract between Stantec and the Client. The opinions in the document are based on conditions and information existing at the time the document was published and do not take into account any subsequent changes. In preparing the document, Stantec did not verify information supplied to it by others. Any use which a third party makes of this document is the responsibility of such third party. Such third party agrees that Stantec shall not be responsible for costs or damages of any kind, if any, suffered by it or any other third party as a result of decisions made or actions taken based on this document.

Prepared by _____
(signature)

Myriame Fraser, Eng.
OIQ # 5012847

Approved by _____
(signature)

Alessandro Cirella, Eng and Project Manager
OIQ #105497

Revision	Description	Author		Quality validation		Independant review	
0	Final Report	Myriame Fraser	2020-03-03	Alessandro Cirella	2020-02-25	Sylvain Bédard	2019-12-06
A	Preliminary Report	Myriame Fraser	2020-02-05	Alessandro Cirella	2019-10-01	Sylvain Bédard	2019-12-06



Table of Content

1.0	SCOPE OF WORK	1
1.1	DESCRIPTION OF PROJECT AND WORK PLAN	1
1.2	REFERENCE DOCUMENTS.....	1
2.0	BRIDGE DESCRIPTION	2
2.1	WEMINDJI ACCESS ROAD BRIDGE LOCATION.....	2
2.2	STRUCTURE DESCRIPTION	3
2.3	STRUCTURE DIMENSIONAL PARTICULARITY	6
3.0	INSPECTION AND INVESTIGATION ACTIVITIES	7
3.1	INSPECTION TEAM AND TIME FRAME.....	7
3.2	METHODOLOGY AND ACCESS DEVICES	7
4.0	INSPECTION OBSERVATIONS	8
4.1	APPROACHES.....	8
4.1.1	Road Pavement Transition	8
4.1.2	Embankments	11
4.1.3	Slope protection	11
4.1.4	Railing systems	12
4.2	ABUTMENTS.....	14
4.2.1	Abutment’s foundation.....	15
4.2.2	Abutment front walls	15
4.2.3	Sidewalls	17
4.2.4	Abutments bearings.....	17
4.2.5	Abutments’ bearing seat and bearings pedestals	20
4.2.6	Ballast Wall.....	20
4.2.7	Hollow Abutments’ interior	21
4.3	PIER.....	23
4.3.1	Pier foundation	23
4.3.2	Pier-wall	24
4.3.3	Pier cap and bearings’ seat	25
4.3.4	Bearings	26
4.4	STEEL STRUCTURE AND CONNECTORS.....	26
4.4.1	Beams.....	26
4.4.2	Bracings	27
4.5	DECKING, BRIDGE SURFACE AND SAFETY DEVICES	29
4.5.1	Bridge deck	29
4.5.2	Wearing surface	30
4.5.3	Curbs.....	31
4.5.4	Guardrails.....	32
5.0	CONCLUSIONS	35
5.1	BRIDGE ENLARGEMENT	35



LIST OF FIGURES

Figure 1 : *Bridge Location* 2
 Figure 2 : *Bridge Environment* 3
 Figure 3 : *North Elevation* 4
 Figure 4 : *Beams and wood deck* 4
 Figure 5 : *Bridge Profile View* 5
 Figure 6 : *Deck detail* 6
 Figure 7 : *Foot and Rope Access Inspection* 7
 Figure 8 : *Western approach* 8
 Figure 9 : *Eastern approach* 9
 Figure 10 : *Western approach transition* 9
 Figure 11 : *Eastern approach transition* 10
 Figure 12 : *Embankments* 11
 Figure 13 : *Slope protection, wingwall no.1* 11
 Figure 14 : *Wood and galvanized steel Guardrails* 12
 Figure 15 : *Concrete guardrails* 13
 Figure 16 : *Front Walls general views* 15
 Figure 17 : *Cold joint and narrow cracks on the East front wall* 16
 Figure 18 : *Cold joint and narrow cracks on the West front wall* 16
 Figure 19 : *Sidewalls* 17
 Figure 20 : *Debris on the bearing pedestals (West and East)* 20
 Figure 21 : *Ballast walls (Left: West and Right: East)* 20
 Figure 22 : *West abutment's interior* 21
 Figure 23 : *East abutment's interior* 22
 Figure 24 : *Pile foundation* 23
 Figure 25 : *Pier faces* 24
 Figure 26 : *Pier cap* 25
 Figure 27 : *Pile's bearing seat* 26
 Figure 28 : *Pile's bearings and pedestals* 26
 Figure 29 : *Beams general views* 27
 Figure 30 : *Bracings* 29
 Figure 31 : *Bridge deck – wood timbers* 30
 Figure 32 : *Wooden Plank Surface* 31
 Figure 33 : *Road curb* 32
 Figure 34 : *Wood guardrails – span 1* 33
 Figure 35 : *Wood guardrails – span 2* 34

LIST OF TABLES

Table 1 : *Principal bridge dimensional characteristics* 5
 Table 2 : *Railing system's deficiencies* 13
 Table 3 : *Abutment bearings deficiencies* 18

LIST OF APPENDICES

- APPENDIX A** Detailed dimensional inventory
- APPENDIX B** Damage survey sketches
- APPENDIX C** Photo Report



1.0 SCOPE OF WORK

The present section describes the project and work plan of the Wemindji Access Road bridge and the reference documents used in the present damage survey report.

1.1 DESCRIPTION OF PROJECT AND WORK PLAN

In the early-1990's the Cree Nation of Wemindji built its first road access to the community. A 96 km long road is now linking the community to the James Bay Highway. This road is still the only access the community has to the provincial road network. A single traffic lane bridge, over the Maquatua River, is located on the access road approximately 3 km East of the community.

The Cree Nation Government has expressed its desire to validate the feasibility of enlarging the present one lane bridge on the Wemindji Access Road to a two lanes bridge. In order to do this, Stantec was mandated by the Cree Nation Government to provide engineering services for carrying out a damage survey and recommending further maintenance activities. The damage survey report is necessary prior to any feasibility studies for the road bridge enlargement. The program consists in carrying out all the activities related to conducting the detailed inventory, the damage survey and then recommending further maintenance activities keeping in mind the plan to enlarge the bridge roadway.

This report presents the defects observed by Stantec's Inspection team during the damage survey performed in august 2019. The purpose of the survey is to determine the actual bridge condition in order to present maintenance and rehabilitation options in the next phase for the road bridge enlargement. This report is also to detect any material defects that may affect the structure's components, evaluate its condition state and detect any other suspected performance deficiencies regarding public safety, comfort and convenience. Also, a complete dimensional survey was made during the damage survey.

1.2 REFERENCE DOCUMENTS

The damage survey was conducted in accordance with the following documents, published by the Quebec Ministry of Transportation or given to Stantec by the Cree Nation Government:

- Manuel d'inspection des structures, Quebec Ministry of Transportation, published in January 2017;
- Manuel d'inventaire des structures, Quebec Ministry of Transportation, published in January 2017;
- Manuel d'entretien des structures, Quebec Ministry of Transportation, published in January 2016.
- Manuel d'évaluation de la capacité portante de ponts, Quebec Ministry of Transportation, published in february 2015.
- Professional Services proposal – General Inspection and Damage survey of the Access Road Bridge in Wemindji, Stantec, April 2018.



2.0 BRIDGE DESCRIPTION

This section presents the Wemindji access road bridge location and its structural description.

2.1 WEMINDJI ACCESS ROAD BRIDGE LOCATION

The Wemindji Access Road Bridge is located about 3 km East from the inlet of the Cree Nation of Wemindji, above the Maquatua River. The Cree Nation of Wemindji sits at the mouth of the Maquatua River on the east coast of James Bay in the Nord-du-Québec administrative region in the province of Québec, Canada.

The purpose of the bridge is to cross the Maquatua River. One lane with shoulders allows the vehicles to enter or exit Wemindji. It is also the only road access to the community.

Figure 1 : Bridge Location



The Wemindji Access road bridge's is a one lane bridge on a two lane gravel road, one lane in each direction. No houses or buildings are located near the bridge approaches. Bridge is erected over the Maquatua river and its environment consists of a vast wooded forest.



Figure 2 : Bridge Environment



2.2 STRUCTURE DESCRIPTION

The bridge has a structure made of a timber deck on steel girders. It features two non-symmetric spans of four straight steel beams supported by a concrete pier and two concrete abutments. The abutments are hollowed. Each span is independent and simply supported.

The road deck surface (single traffic lane) is made of wood planks while the approaches on both sides are in asphalt. The rest of the access road is in gravel and is undergoing resurfacing process to be paved in 2020.



Figure 3 : North *Elevation*



Figure 4 : *Beams and wood deck*



The principal dimensional characteristics are listed in the table below and the complete detailed dimensional inventory can be found in Appendix A.

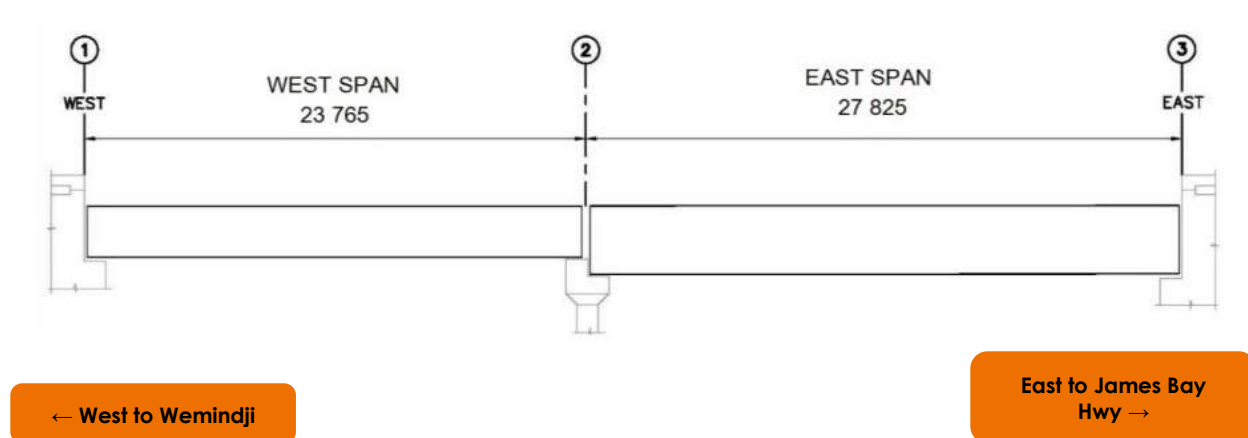


Table 1 : Principal bridge dimensional characteristics

Bridge characteristics	Dimensions (m)
Bridge total length (including deck and side walls)	68,905 m
Total deck length (wood timbers)	51,32 m
Deck length (wood timbers), by span	<ul style="list-style-type: none"> • West span: 23,61 m • East span: 27,71 m
Spans length (pier center / abutment wall face)	<ul style="list-style-type: none"> • West span: 23,765 m • East span: 27,825 m
Bridge lane width	6,050 m (single lane)

Axis number “1” is located at the west side of the bridge (west to Wemindji), axis number “2” is located in the center of the pier and axis number “3” is at the east side of the bridge, (east to James bay highway), as shown on the bridge profile view below:

Figure 5 : Bridge Profile View




Girder number “1” is located south, and number are increasing to beam number “4”, located on the North side of the deck. Sidewalls are numbered according to cardinal points: side wall no.1 is South-West, sidewall no.2 is North-West, side wall no.3 is South-East and side wall no.4 is North-East.



2.3 STRUCTURE DIMENSIONAL PARTICULARITY

The deck of Wemindji access road bridge is made of wood timbers and the wearing surface is also made of wood planking surface. The wood planking surface is slightly longer than the deck length (wood timbers) because it sits on a ledge at the top of the abutment walls. An open joint (space) is present between the ballast wall and the first wood timber of the deck. The structural detail is shown in the picture below.

Figure 6 : Deck detail

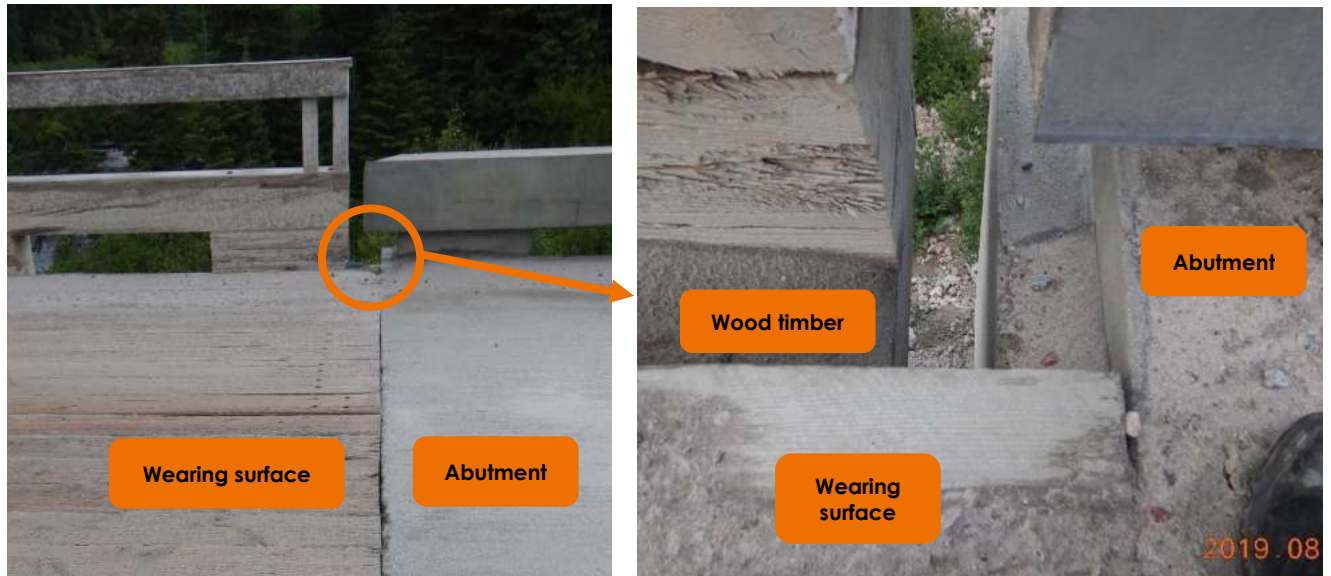

3.0 INSPECTION AND INVESTIGATION ACTIVITIES

This section of the report describes the inspection team and time frame, the methodology and the access devices used for the realization of the damage survey.

3.1 INSPECTION TEAM AND TIME FRAME

The field inspection was conducted from August 6 to 7 during daytime. Inspectors on field were Ms. Myriame Fraser, eng., Mr. Simon Lefebvre, junior technician and Mr. Sébastien Daigneault, senior technician, under direct supervision of the project manager, Mr Alessandro Cirella.

The temperature varied between 13 °C to 25 °C, cloudy and rainy.

3.2 METHODOLOGY AND ACCESS DEVICES

The following methods were used to access and inspect every element of the structure at arm's length:

- Foot inspection on and around the bridge: abutments, deck surface, curbs and guards;
- Rope access inspection: steel beams and bracings, bearings, concrete pier, concrete abutment walls and wood deck's underside.

These items were subject to a arms length inspection as prescribed in the *Manuel d'inspection des structures*.

Figure 7 : Foot and Rope Access Inspection



4.0 INSPECTION OBSERVATIONS

This section provides a general overview of the major damage found to the structure. The defects are presented by group of elements. Photos of the main defects are presented in this report to illustrate the comments, while all the photos taken during the inspection are presented in the appendix C.

4.1 APPROACHES

This section is covering the main elements of both approaches of the structure; road pavement transition, embankments and guardrails.

4.1.1 Road Pavement Transition

The access road leading to the bridge is entirely made of gravel except at the bridge's approaches. Two types of surface compose the approaches: asphalt and concrete.

The approaches' asphalt pavement is making the transition between the gravel and the concrete surface (concrete deck of the hollowed abutments). It is damaged by cracks and potholes that allows the water to infiltrate the infrastructure under the pavement and possibly accelerate its deterioration. A concrete slab serves as pavement transition between the asphalt approaches and the wooden planks. No expansion joint is separating the different materials.

Figure 8 : Western approach



Figure 9 : Eastern approach



A smooth transition for the vehicles is critical in order to eliminate any impact on the structure itself or any impact to the approach. West approach provides a smooth transition between the approaches' surface and the bridge; wooden planking and the asphalt of the approach are at the same level.

Figure 10 : Western approach transition



Eastern approach presents a slight unevenness between the concrete part and the wooden planking of the bridge deck that may cause low impact on the structure.

Figure 11 : Eastern approach transition



4.1.2 Embankments

The embankments are made of sand and gravel. No loss of granular material was identified at each corner of the approaches or in front of the abutment's walls. Embankments are in good condition.

Figure 12 : Embankments



4.1.3 Slope protection

The purpose of the slope protection is to prevent the erosion of the embankment material. The slope protection is made of stones of different diameters. While some plants are growing through the stones and some sliding of stones at the top of the slope protection (wingwall no. 1) was observed, its condition is good.

Figure 13 : Slope protection, wingwall no.1



4.1.4 Railing systems

The bridge has two types of railing systems on its approaches. The first railing system is made of wood posts and galvanized steel rails (flex beams) and is followed by a concrete barrier made of concrete posts and concrete railing, above the hollowed abutments.

At first, guardrails are the first protection device while approaching the bridge. A guardrail is a semi-rigid structure made of galvanized steel and wood. Its purpose is to slide the vehicle that might leave the road. Wood and galvanized steel guardrails are installed on both approaches. Wooden posts are in bad condition (some are broken, and some are decayed) and the galvanized steel railings are deformed by impacts. Extremities of galvanized steel railings were possibly hit by cars and are deformed and/or torn up at each end of the structure. No rigidity transition is in place between the semi-rigid wood and steel railing and concrete rigid guardrails.

Figure 14 : Wood and galvanized steel *Guardrails*



The second device is made of concrete rails and concrete posts covered with a “C” formed steel channel. Those concrete guardrails are located at the top of the four sidewalls. No material defect was noted on the concrete barriers and their condition is good.




Figure 15 : Concrete guardrails



Also, no connection system is in place between the two types of railings, creating a gap between the two elements. This detail is typical and can be seen at each corner of the structure.

The deficiencies' resume, described for each corner of the structure, can be found in the table below.

Table 2 : Railing system's deficiencies

West approach		
North-West corner		
		
Permanent deformation of flex beam and torn up guardrail.	Broken wood posts offset blocks	No connection device between the wood and galvanized steel railing and the concrete barrier



West approach		
South-West corner		
		
Permanent deformation of guardrail and torn guardrail.	Permanent deformation of guardrail and torn guardrail. Two broken wood posts.	No connection device between the wood and galvanized steel railing and the concrete barrier
East approach		
North-East corner		
		
Permanent deformation of guardrail and torn guardrail extremity.	Torn guardrail.	No connection device between the wood and galvanized steel railing and the concrete barrier
East approach		
South-East corner		
		
Permanent deformation of guardrail and torn guardrail.	Permanent deformation of guardrail.	No connection device between the wood and galvanized steel railing and the concrete barrier

4.2 ABUTMENTS

This section refers to the inspection of the different elements of the abutments on both shores (axis 1 and 3). This bridge's abutments are U-shaped (Side walls perpendicular to the front wall) and hollowed (no backfill).



4.2.1 Abutment's foundation

Abutment's foundations are not visible. No visible movement of the abutments was observed at the time of the damage survey; therefore, they are considered in good condition.

4.2.2 Abutment front walls

The front walls of the abutment are perpendicular to the bridge alignment. Both abutment walls are in good condition. Narrow cracks (width opening < 0,8 mm) and cold joints in concrete were identified on each front wall. General views of each front walls and typical cracks are shown in the figures below.

Figure 16 : Front Walls general views

West abutment / Axis 1



East abutment / Axis 3



Figure 17 : Cold joint and narrow cracks on the East front wall



Figure 18 : Cold joint and narrow cracks on the West front wall



4.2.3 Sidewalls

The sidewalls of the abutment are parallel to bridge alignment. It has a hole in each sidewall (a door 1000 x 1200 mm) leading to the inside of the abutment.

No concrete deficiencies were found on the side walls, except for narrow cracks in concrete (width opening < 0,8 mm). Sidewalls are in good condition.

Figure 19 : Sidewalls






4.2.4 Abutments bearings

The bearing type installed on both abutments are made of steel plates and elastomeric plates. Some bent and sectioned bolts were noted on each abutment bearings. The description of the deficiencies found on the abutment bearings are listed in the table below.






Table 3 : Abutment bearings deficiencies

East abutment		
Beam #1	One sectioned bolt	 A photograph showing a sectioned bolt in a concrete abutment. The bolt is broken and surrounded by debris and dirt. The date stamp '2019.08.07' is visible in the bottom right corner.
Beam #2	One bent bolt	 A photograph showing a bent bolt in a concrete abutment. The bolt is curved and appears to be under stress. The date stamp '2019.08.07' is visible in the bottom right corner.
Beam #3	One sectioned bolt	 A photograph showing a sectioned bolt in a concrete abutment. The bolt is broken and surrounded by debris. An orange circle highlights the broken bolt. The date stamp '2019.08.07' is visible in the bottom right corner.



WEMINDJI ACCESS ROAD BRIDGE OVER THE MAQUATUA RIVER - 2019 DAMAGE SURVEY

Beam #4	One sectioned bolt (interior face)	
	One bent and loose bolt (exterior face)	
West abutment		
Beam #1	One bent bolt	
Beam #2	No deficiencies	
Beam #3	No deficiencies	
Beam #4	No deficiencies	



4.2.5 Abutments' bearing seat and bearings pedestals

Concrete bearing pedestals are located under each end beam on the bearing seat. Bearing pedestals' dimensions are approximately 950 mm long x 1030 mm width x 150 mm height. No concrete deficiencies such as delamination or spalling was noted on these elements. Debris are covering the most part of the bearing seat and the bearing pedestals of both abutments. Bearing seat and bearings pedestals are in good condition.

Figure 20 : Debris on the bearing pedestals (West and East)



4.2.6 Ballast Wall

Ballast walls of west and east abutments are in good condition. No concrete deficiencies were noted on these elements. Narrow cracks were observed (width opening < 0,8 mm).

Figure 21 : Ballast walls (Left: West and Right: East)



4.2.7 Hollow Abutments' interior

Both abutments' interior are accessible through an opening in the sidewalls. Walls and deck soffits of both abutments are in good condition. Narrow cracks were noted on the concrete (width opening < 0,8 mm).

Figure 22 : West abutment's interior



Figure 23 : East abutment's interior

West wall (back of the front wall)



East wall



South wall



North wall



East abutment: Deck soffit



West abutment: Deck soffit



4.3 PIER

The pier is the system that transfer the load from the deck to the foundations on the riverbed. It is composed of a foundation, a pier-wall and a pier cap (all made of reinforced concrete). Access road Wemindji bridge has one pier and it is located at axis no. 2.

4.3.1 Pier foundation

The foundation sits on the riverbed. The low level of water allowed the visualisation of this element, normally in the water.

The pillar foundation is in good condition. No movement of the structure and no loss of material under the foundation were observed at the time of the damage survey.

Figure 24 : Pile foundation

West elevation



Looking North-West



Looking South-West



4.3.2 Pier-wall

The pier-wall is the concrete element that transfers the load from the pier cap to the foundation. Both ends are shielded by a steel plate. The wall is in good condition, both concrete and steel plates. Narrow cracks were observed in the concrete (width opening < 0,8 mm).

Figure 25 : *Pier faces*

West face



East face



4.3.3 Pier cap and bearings' seat

The pier cap is located above the pier-wall. The cap has different height on each side. the East side is shorter than the West side due to the different beams' height for different span lengths.

The pier cap is in good condition. Narrow cracks were observed on the concrete surfaces.

The bearing seat is located at the top of the pier cap. Debris are covering some parts of the pier's bearings' seat. Bearing seats are in good condition.

Figure 26 : Pier cap

General views



Vertical crack width < 0.8 mm



Pier cap – South face



Figure 27 : Pile's bearing seat



4.3.4 Bearings

Concrete bearings (steel plates and elastomeric plates) and pedestals are located under each beam. The bearings are in good condition. Bearing pedestals are in good condition and no defects were identified.

Figure 28 : Pile's bearings and pedestals



4.4 STEEL STRUCTURE AND CONNECTORS

Steel elements are supporting each span. These elements are the beams and the bracings which are connected altogether by steel connectors, such as bolts.

4.4.1 Beams

All beams are "I" shaped plate girder and made of Atmospheric Corrosion-Resistant Notch-Tough Steel. Each span is supported by 4 beams. Since the spans are asymmetric, their dimensions vary. Detailed dimension can be found in the detailed dimensional inventory in appendix A.



Beams are in good condition. No important steel section loss was noted in the damage survey.

Figure 29 : Beams general views



4.4.2 Bracings

Bracings are connecting the beams together and providing lateral support. The purpose of the bracings is to transfer the lateral forces, such as the wind, to the beams. Diaphragms are located under the deck and are perpendicular to the beams.

Span 1 has four intermediate vertical transverse bracings and one end vertical transverse bracing at each end. No horizontal bracings are present between beams of span 1. All bracings of span 1 are in good condition.

Span 2 has nine intermediate vertical transverse bracings and one end vertical transverse bracing at each end. Span 2 also has ten horizontal bracings between beams 2 and 3. All bracings of span 2 are in good condition.





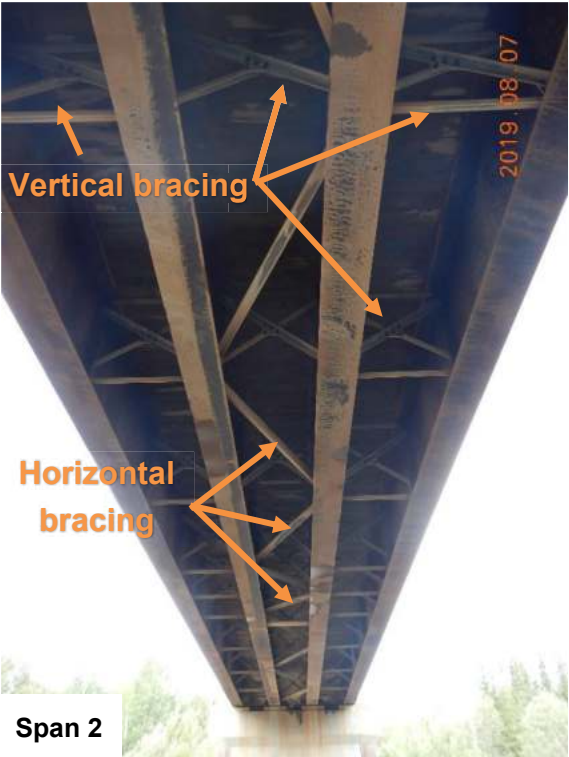


Figure 30 : Bracings


Span 1 – Intermediate vertical transverse bracings

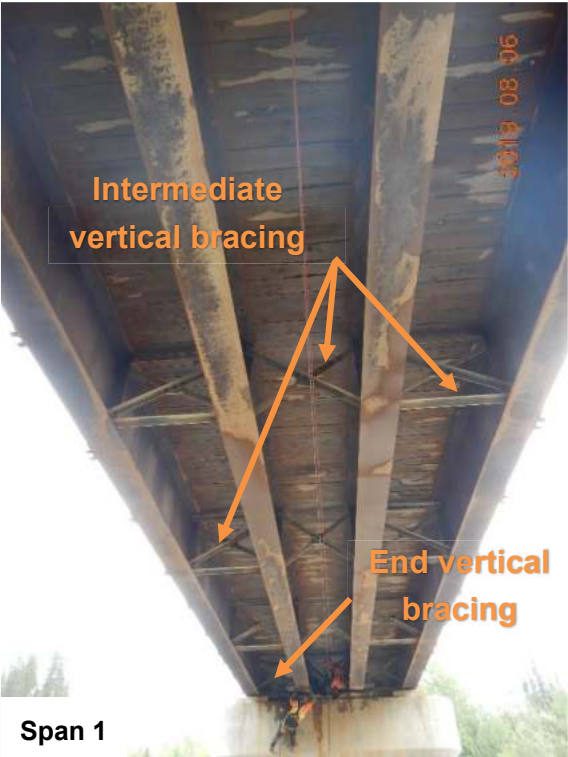

Span 1 – End vertical transverse bracings

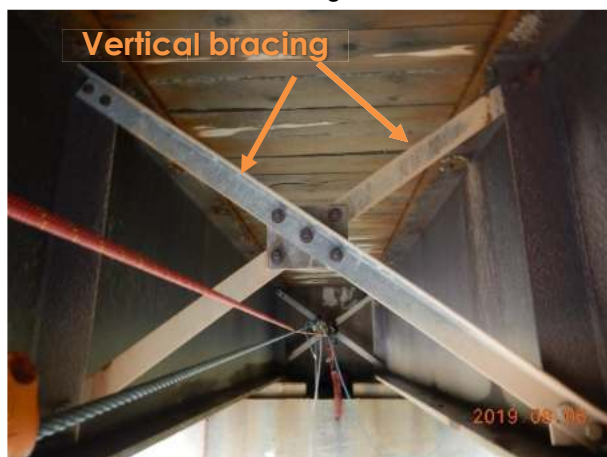

Span 2 – Intermediate vertical transverse bracings and horizontal bracings

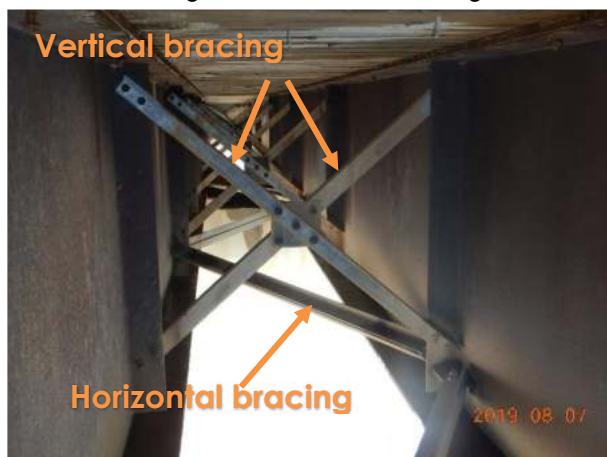

Span 1 – End vertical transverse bracings (pier 2)



4.5 DECKING, BRIDGE SURFACE AND SAFETY DEVICES

This section covers all the elements forming the deck and the elements above it: the wood timbers of the deck itself, the wooden wearing surface, the wood curbs and the wooden railing system.

4.5.1 Bridge deck

The bridge deck is made of timbers. A wooden wearing surface on it make it only visible from its underside, between the beams and on the exterior sides (north and south).

Wood timbers are in good condition.



Figure 31 : Bridge deck – wood timbers

Span 1 – Timbers between beams



Span 1 – Timbers' extremity



Span 2 – Timbers between beams



Span 2 – Timbers' extremity




4.5.2 Wearing surface

The wearing surface is made of wooden planks. The roadside (25% of the surface) is covered of sand and debris, which makes it not possible to inspect. The visible part of the surface (the clean part) has 5% of its wooden planks with important decay. Another 5% has very important decay. A few bolts were scattered on the surface. There is no joint on the wearing surface above the pile. The wearing surface is in a fair condition.



Figure 32 : Wooden Plank Surface

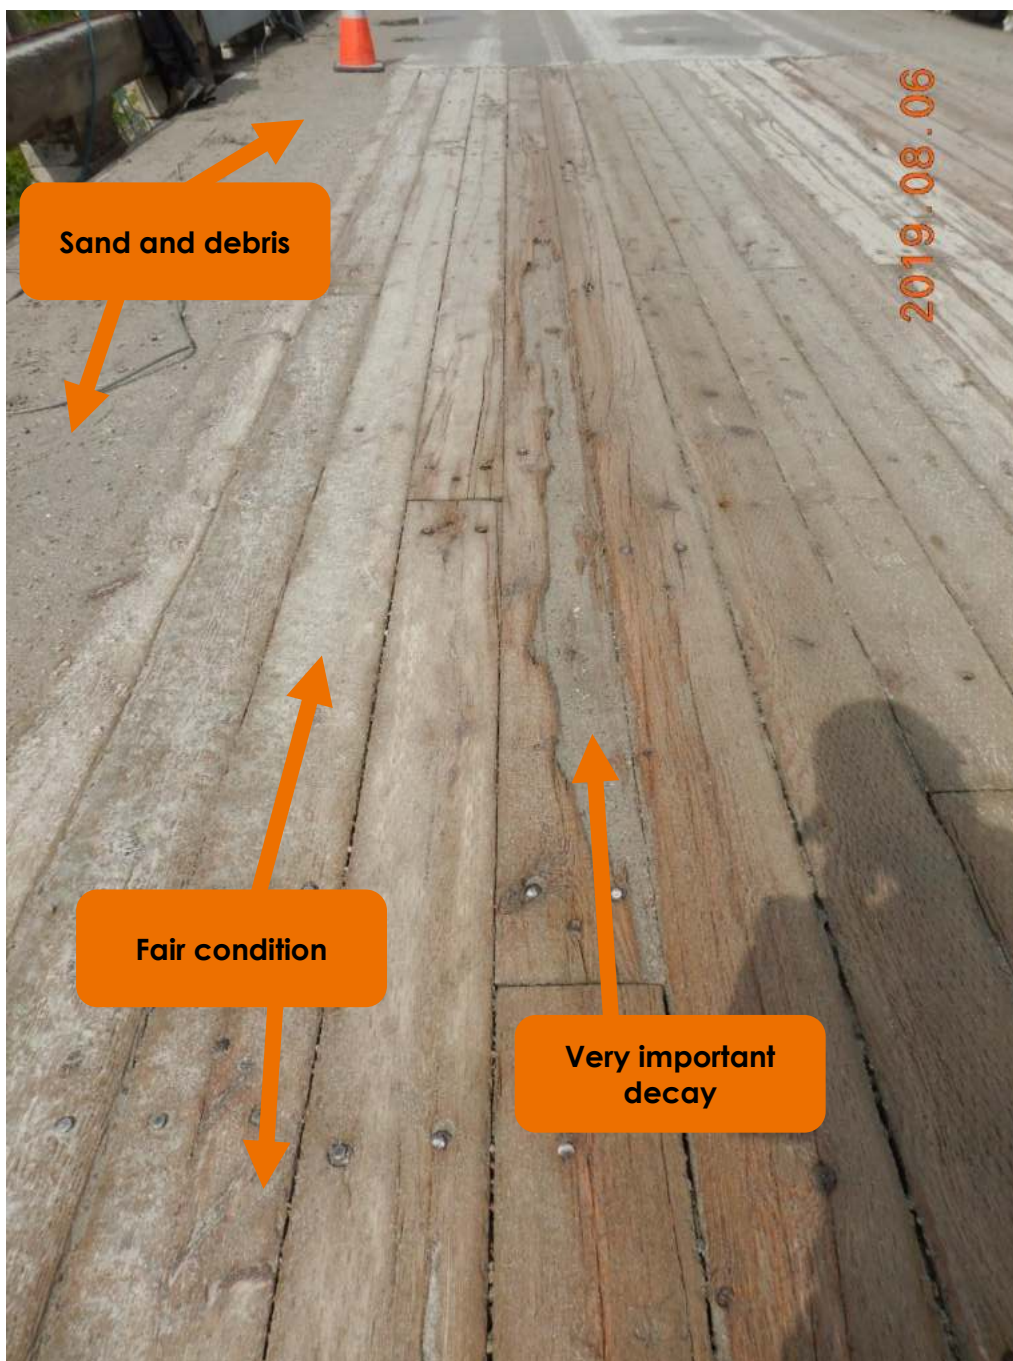

4.5.3 Curbs

The wood curbs are located along the guardrails, next to the road surface. They are made of 300 mm x 300 mm section wood pieces on wood anchor blocks.

The curbs are in good condition. In both spans, they present medium abrasion on its corner.



Figure 33 : Road curb



4.5.4 Guardrails

Both sides of the bridge are protected by wood guardrails. In some places, the posts of the guardrails are not fixed to the timbers, where they should be. Instead, they are fixed to the curbs or the anchor of the curbs. At some places, posts are cut. Therefore, the condition of the guardrails is judged to be poor.

Typical defects of the guardrails are shown in the pictures below.



Figure 34 : Wood guardrails – span 1



Figure 35 : Wood guardrails – span 2



5.0 CONCLUSIONS

To summarize, the bridge is in a good condition. No defects were identified on the concrete abutments, the steel beams and transverse wooden timbers are in good condition. No major repair is needed at this time. For further modifications to the structure, it is important to keep in mind the abutments are hollowed but in good condition and accessible by 2 openings.

However, the few defects and problems identified during the inspection show that maintenance has to be done on specific elements to ensure the sustainability of the structure. The wooden wearing surface is partially decayed and should be scheduled to be replaced in the next 5 to 10 years. In the eventuality where the structure enlargement project goes forward, it should be considered to use the same contract to replace the wooden wearing surface on the existing bridge. Estimation cost for the replacement of the wood surface is \$45,000.

The guardrail posts on the bridge are deficient (not fixed to the transverse beams) and there is no stiffness transition and link between the flexible guard rails on the approaches and the concrete rails on the concrete slab. To ensure security of the users, corrective work is to be done in the short term. Repair of the guardrail is estimated at \$24,900.

Finally, it was observed that a few anchor rods were deformed or sectioned at the bearings. Regular observations of the bridge should be conducted to make sure there is no further movement of the deck and there is no displacement of the bearings. Again, in the eventuality where the structure enlargement project goes forward, it should be considered to use the same contract to replace the damaged anchor on the existing bridge. Estimation cost for the replacement of the anchors is \$18,800.

The cost estimates are based on the MTQ suggested costs per activities and include a 25% contingency. The total costs are estimated at \$88,700. This estimate does not include the mobilization, demobilization and the managing costs of the construction firm which can vary from 30 to 50% given the location.

5.1 BRIDGE ENLARGEMENT

The bridge foundation elements (pier, abutments) and structural steel system are in good condition. It is acceptable to maintain this structure in good service for many more years as long as normal maintenance is done. From the state of the bridge observed during the damage survey, many options are possible to enlarge the traffic lane of the bridge: A new one lane bridge can be built parallel to the existing one, or concrete pier and abutment can be enlarged on one or both sides to add more girders and then enlarge the deck surface. Solutions and cost estimation can be discussed further in the future feasibility study.



APPENDIX A
DETAILED DIMENSIONAL INVENTORY



APPENDIX B
Damage survey sketches



APPENDIX C

Photo report



APPENDIX A

DETAILED DIMENSIONAL INVENTORY



DETAILED DIMENSIONAL INVENTORY IDENTIFICATION

Identification

Structure	Main road bridge		
Municipality	Wemindji		
Responsibility	Cree nation Government		

Location

Latitude	53,012564	Longitude	-78,77033
Site	Wemindji access road - 3km east from Wemindji		
Orientation	East-West		
Point of reference	West to Wemindji		

Obstacles

Name	Maquata River
------	---------------

Road

Name	Wemindji access road
Number of lanes	One lane bridge
Clear width	6,050 m

General dimensions

Total bridge length, including sidewalls	68,905 m
Deck length (wood timbers)	51,320 m
Total width	7,0 m
Bridge lane width (one lane bridge)	6,05 m
Deck area	327 m ²
Deck angle	0 degree

Year

Construction	1990
Abutments and pile	1990
Structural system	1990
Deck	1990

Span

Span identification	Type of structure	Span length (mm)	End connection S/W	End connection N/E	Beam spacing (mm)	Foundation S/W	Foundation N/E
1 - West span	Wood deck on steel beams	23 765	Simply supported	Simply supported	1 500	Concrete abutment	Concrete pile
2 - East span	Wood deck on steel beams	27 825	Simply supported	Simply supported	1 500	Concrete pile	Concrete abutment



Public services

Type	Location
Powerline	North side, 11,0 m from structure

DETAILED DIMENSIONAL INVENTORY

Element list

Main road bridge to Wemindji

Span #	Element Group	Element	Type	Material	Reinforcement	Prot. Syst.	Ele. #	Position	Length (mm)	Width (mm)	Height (mm)	Calc. Qty	Unit	Envir.	Remarks
1	Stream and embankment	Stream													
1	Stream and embankment	Embankment	Granular					West							
1	Stream and embankment	Slope protection	Stones					West							
1	Substructure / Abutment	Foundation	Undetermined				1	West							
1	Substructure / Abutment	Abutment front wall	Reinforced concrete	Regular concrete	Steel reinforcement		1	West		7030	4800	34	m ²	Moderate	
1	Substructure / Abutment	Ballast wall	Reinforced concrete	Regular concrete	Steel reinforcement		1	West		7030	1700	12	m ²	Moderate	
1	Substructure / Abutment	Bearing pedestals	Reinforced concrete	Regular concrete	Steel reinforcement		1	West	1030	950	150	4	unit(s)	Moderate	Pedestals dimensions vary
1	Substructure / Abutment	Bearings	Steel plates + elastomer plates				1	West				4	unit(s)	Moderate	
1	Substructure / Abutment	Sidewall	Reinforced concrete	Regular concrete	Steel reinforcement		1	South-West	8600		3330	29	m ²	Moderate	Height varies from 860 to 5800 mm
1	Substructure / Abutment	Sidewall	Reinforced concrete	Regular concrete	Steel reinforcement		2	North-West	8600		2790	24	m ²	Moderate	Height varies from 550 to 5030 mm
1	Substructure / Abutment	Bearing seat	Reinforced concrete	Regular concrete	Steel reinforcement		1	West	1210	7030		9	m ²	Moderate	
1	Substructure / Pier	Foundation	Undetermined				2								
1	Substructure / Pier	Pier cap	Reinforced concrete	Regular concrete	Steel reinforcement		2		2060	7080	1570	25	m ²	Moderate	Height varies from 1200 to 1570 mm
1	Substructure / Pier	Pier - wall	Reinforced concrete	Regular concrete	Steel reinforcement		2		1400	6380	5690	89	m ²		Width varies from 5010 to 6380 mm
1	Substructure / Pier	Bearing pedestals	Reinforced concrete	Regular concrete	Steel reinforcement		2		925	935	165	4	unit(s)	Moderate	Pedestals dimensions vary
1	Substructure / Pier	Bearing pedestals	Reinforced concrete	Regular concrete	Steel reinforcement		3		935	920	165	4	unit(s)	Moderate	Pedestals dimensions vary
1	Substructure / Pier	Bearings	Steel plates + elastomer plates				2					4	unit(s)	Moderate	

DETAILED DIMENSIONAL INVENTORY

Element list

Main road bridge to Wemindji

Span #	Element Group	Element	Type	Material	Reinforcement	Prot. Syst.	Ele. #	Position	Length (mm)	Width (mm)	Height (mm)	Calc. Qty	Unit	Envir.	Remarks
1	Substructure / Pier	Bearings	Steel plates + elastomer plates				3					4	unit(s)	Moderate	
1	Substructure / Pier	Bearing seat	Reinforced concrete	Regular concrete	Steel reinforcement		2		2060	7080		15	m ²	Moderate	West part of the bearing seat: 1000 mm width East part of the bearing seat: 1060 mm width
1	Deck	Deck	Wood deck	Wood					23610	6380		151	m ²	Severe	Timber length = 6380 mm
1	Deck	Wearing surface	Wood planking wearing surface	Wood					23815	5830		139	m ²	Severe	Carriageway = 5830 mm and the space between the curbs = 6050 mm
1	Superstructure / Beams	Beam	Welded beam	Atmospheric corrosion resistant notch tough steel			1		23630	410	1200	86	m ²	Moderate	
1	Superstructure / Beams	Beam	Welded beam	Atmospheric corrosion resistant notch tough steel			2		23630	410	1200	86	m ²	Moderate	
1	Superstructure / Beams	Beam	Welded beam	Atmospheric corrosion resistant notch tough steel			3		23630	410	1200	86	m ²	Moderate	
1	Superstructure / Beams	Beam	Welded beam	Atmospheric corrosion resistant notch tough steel		Other	4		23630	410	1200	86	m ²	Moderate	
1	Bracings	Vertical bracing	Transverse	Galvanized steel		Other		End				2	unit(s)	Moderate	
1	Bracings	Vertical bracing	Transverse	Galvanized steel		Other		Intermediate				4	unit(s)	Moderate	
1	Curbs and sidewalks	Curb	Wood curb	Wood		Treated wood		North	23610	300	600	24	m	Severe	Wood curb: 300 mm width x 300 mm height on anchor wood block 300 mm width x 300 mm height
1	Curbs and sidewalks	Curb	Wood curb	Wood		Treated wood		South	23610	300	600	24	m	Severe	Wood curb: 300 mm width x 300 mm height on anchor wood block 300 mm width x 300 mm height
1	Guard rail	Railing system	Wood railing	Wood		Treated wood		North	23610			24	m	Severe	
1	Guard rail	Railing system	Wood railing	Wood		Treated wood		South	23610			24	m	Severe	
1	Approaches	Transition						West							
1	Approaches	Railing system	Wood and steel	Wood and steel				West	26880			27	m	Severe	
2	Stream and embankment	Embankment	Granular					East							

DETAILED DIMENSIONAL INVENTORY

Element list

Main road bridge to Wemindji

Span #	Element Group	Element	Type	Material	Reinforcement	Prot. Syst.	Ele. #	Position	Length (mm)	Width (mm)	Height (mm)	Calc. Qty	Unit	Envir.	Remarks
2	Stream and embankment	Slope protection	Stones					East							
2	Substructure / Abutment	Foundation	Undetermined				3	East							
2	Substructure / Abutment	Abutment front wall	Reinforced concrete	Regular concrete	Steel reinforcement		3	East		7000	4285	30	m ²	Moderate	
2	Substructure / Abutment	Ballast wall	Reinforced concrete	Regular concrete	Steel reinforcement		3	East		7000	2010	14	m ²	Moderate	
2	Substructure / Abutment	Bearing pedestals	Reinforced concrete	Regular concrete	Steel reinforcement		4	East	1040	950	160	4	unit(s)	Moderate	Pedestals dimensions vary
2	Substructure / Abutment	Bearings	Steel plates + elastomer plates				4	East				4	unit(s)	Moderate	
2	Substructure / Abutment	Sidewall	Reinforced concrete	Regular concrete	Steel reinforcement		3	South-East	8600		4050	35	m ²	Moderate	Height varies from 1300 to 6800 mm
2	Substructure / Abutment	Sidewall	Reinforced concrete	Regular concrete	Steel reinforcement		4	North-East	8600		3190	27	m ²	Moderate	Height varies from 630 to 5750 mm
2	Substructure / Abutment	Bearing seat	Reinforced concrete	Regular concrete	Steel reinforcement		3	East	1200	7000		8	m ²	Moderate	
2	Deck	Deck	Wood deck	Wood					27710	6380		177	m ²	Severe	Timber length = 6380 mm
2	Deck	Wearing surface	Wood planking wearing surface	Wood					27890	5830		163	m ²	Severe	Carriageway = 5830 mm and the space between the curbs = 6050 mm
2	Superstructure / Beams	Beam	Welded beam	Atmospheric corrosion resistant notch tough steel		Other	1		27675	450	1600	126	m ²	Moderate	
2	Superstructure / Beams	Beam	Welded beam	Atmospheric corrosion resistant notch tough steel		Other	2		27675	450	1600	126	m ²	Moderate	
2	Superstructure / Beams	Beam	Welded beam	Atmospheric corrosion resistant notch tough steel		Other	3		27675	450	1600	126	m ²	Moderate	
2	Superstructure / Beams	Beam	Welded beam	Atmospheric corrosion resistant notch tough steel		Other	4		27675	450	1600	126	m ²	Moderate	
2	Bracings	Vertical bracing	Transverse	Galvanized steel		Other		End				2	unit(s)	Moderate	
2	Bracings	Vertical bracing	Transverse	Galvanized steel		Other		Intermediate				9	unit(s)	Moderate	

DETAILED DIMENSIONAL INVENTORY

Element list

Main road bridge to Wemindji

Span #	Element Group	Element	Type	Material	Reinforcement	Prot. Syst.	Ele. #	Position	Length (mm)	Width (mm)	Height (mm)	Calc. Qty	Unit	Envir.	Remarks
2	Bracings	Horizontal bracing	Horizontal	Galvanized steel		Other		Inferior				10	unit(s)	Moderate	
2	Curbs and sidewalks	Curb	Wood curb	Wood		Treated wood		North	27710	300	600	28	m	Severe	Wood curb: 300 mm width x 300 mm height on anchor wood block 300 mm width x 300 mm height
2	Curbs and sidewalks	Curb	Wood curb	Wood		Treated wood		South	27710	300	600	28	m	Severe	Wood curb: 300 mm width x 300 mm height on anchor wood block 300 mm width x 300 mm height
2	Guard rail	Railing system	Wood railing	Wood		Treated wood		North	27710			28	m	Severe	
2	Guard rail	Railing system	Wood railing	Wood		Treated wood		South	27710			28	m	Severe	
2	Approaches	Transition						East							
2	Approaches	Railing system	Wood and steel	Wood and steel				East	26930			27	m	Severe	

APPENDIX B
Damage survey sketches





Stantec

DAMAGE SURVEY


CLIENT: CREE KAYAK OF NIJINOU

STRUCTURE: ACCESS ROAD BRIDGE OVER THE MADUATA RIVER

DATE: 2018/05/10

INSPECTORS: Myrto P. Florou, City of Vancouver Environmental Health; Simon LeBeau, City of Vancouver Environmental Health

GENERAL PLAN VIEW

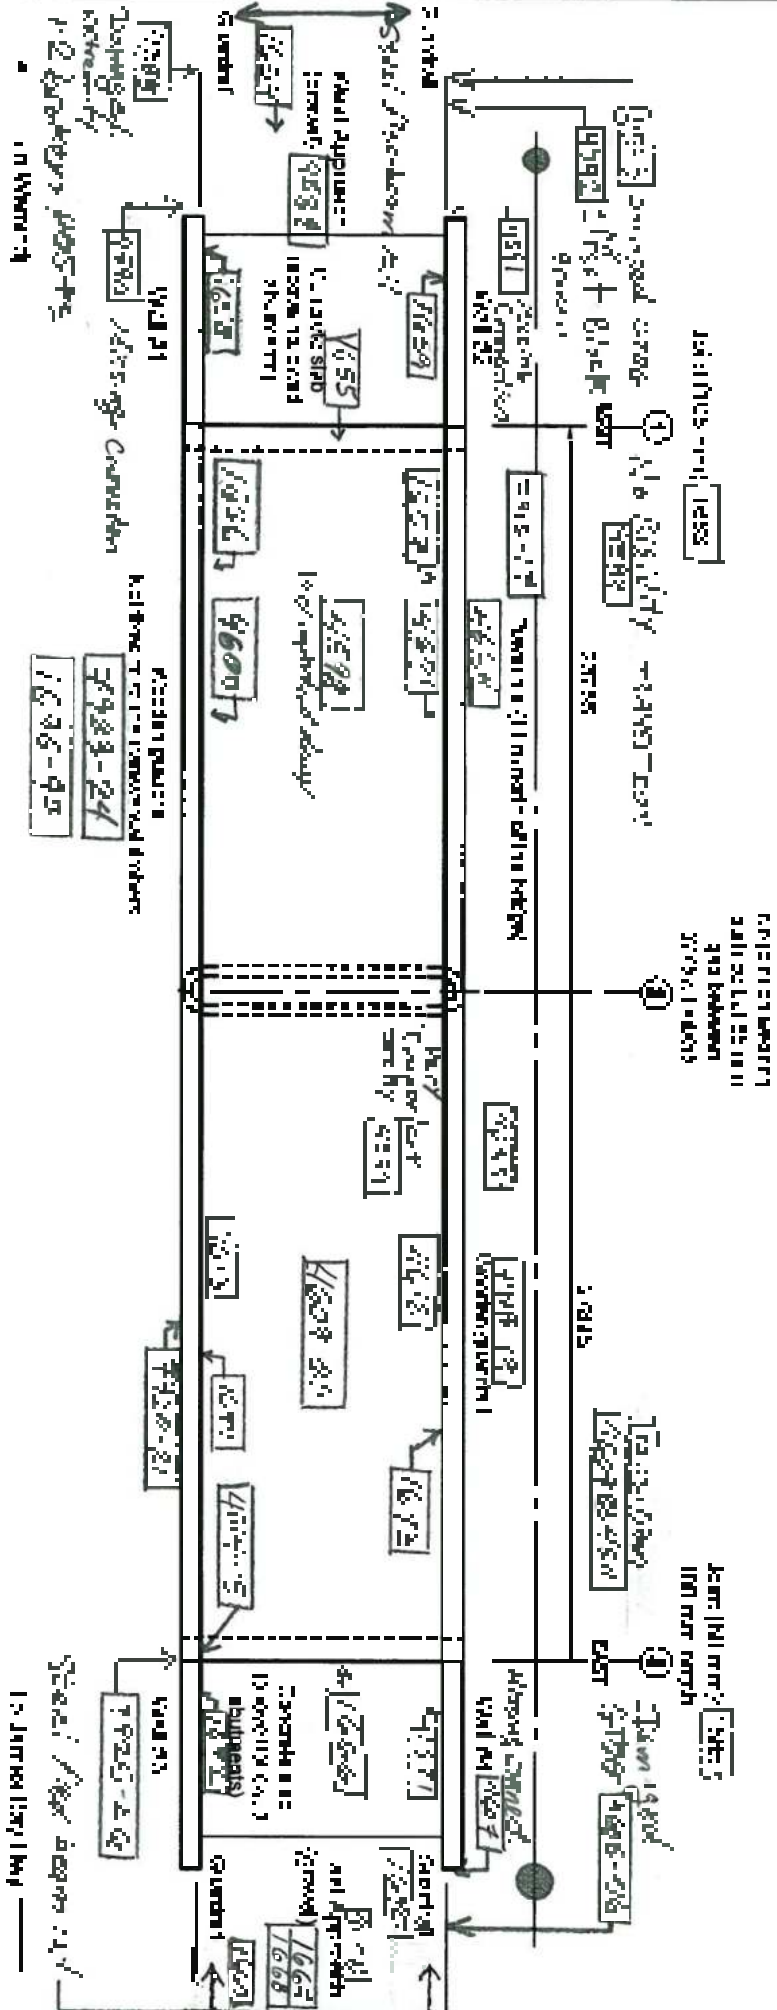

Standard Type Codes
 H: concrete
 W: wood
 G: gypsum
 S: steel
 I: insulation
 P: pipe
 F: floor
 R: roof
 C: ceiling
 W: wall
 D: door
 W: window
 H: handrail
 S: stairs
 L: ladder
 A: access
 E: electrical
 M: mechanical
 P: plumbing
 G: gas
 W: water
 S: sewage
 I: internet
 T: telephone
 C: cable
 A: antenna
 S: satellite
 R: radio
 T: television
 M: monitor
 P: printer
 S: scanner
 F: fax
 C: computer
 A: alarm
 S: sensor
 I: indicator
 L: light
 S: switch
 B: button
 K: key
 P: padlock
 L: lock
 U: unlabeled

Notes:
 1. Damaged entrance
 2. Front + Back gate
 3. No electricity
 4. Electrical panel
 5. 1000 sq ft approx. storage
 6. 1000 sq ft approx. storage
 7. 1000 sq ft approx. storage
 8. 1000 sq ft approx. storage
 9. 1000 sq ft approx. storage
 10. 1000 sq ft approx. storage
 11. 1000 sq ft approx. storage
 12. 1000 sq ft approx. storage
 13. 1000 sq ft approx. storage
 14. 1000 sq ft approx. storage
 15. 1000 sq ft approx. storage
 16. 1000 sq ft approx. storage
 17. 1000 sq ft approx. storage
 18. 1000 sq ft approx. storage
 19. 1000 sq ft approx. storage
 20. 1000 sq ft approx. storage
 21. 1000 sq ft approx. storage
 22. 1000 sq ft approx. storage
 23. 1000 sq ft approx. storage
 24. 1000 sq ft approx. storage
 25. 1000 sq ft approx. storage
 26. 1000 sq ft approx. storage
 27. 1000 sq ft approx. storage
 28. 1000 sq ft approx. storage
 29. 1000 sq ft approx. storage
 30. 1000 sq ft approx. storage
 31. 1000 sq ft approx. storage
 32. 1000 sq ft approx. storage
 33. 1000 sq ft approx. storage
 34. 1000 sq ft approx. storage
 35. 1000 sq ft approx. storage
 36. 1000 sq ft approx. storage
 37. 1000 sq ft approx. storage
 38. 1000 sq ft approx. storage
 39. 1000 sq ft approx. storage
 40. 1000 sq ft approx. storage
 41. 1000 sq ft approx. storage
 42. 1000 sq ft approx. storage
 43. 1000 sq ft approx. storage
 44. 1000 sq ft approx. storage
 45. 1000 sq ft approx. storage
 46. 1000 sq ft approx. storage
 47. 1000 sq ft approx. storage
 48. 1000 sq ft approx. storage
 49. 1000 sq ft approx. storage
 50. 1000 sq ft approx. storage
 51. 1000 sq ft approx. storage
 52. 1000 sq ft approx. storage
 53. 1000 sq ft approx. storage
 54. 1000 sq ft approx. storage
 55. 1000 sq ft approx. storage
 56. 1000 sq ft approx. storage
 57. 1000 sq ft approx. storage
 58. 1000 sq ft approx. storage
 59. 1000 sq ft approx. storage
 60. 1000 sq ft approx. storage
 61. 1000 sq ft approx. storage
 62. 1000 sq ft approx. storage
 63. 1000 sq ft approx. storage
 64. 1000 sq ft approx. storage
 65. 1000 sq ft approx. storage
 66. 1000 sq ft approx. storage
 67. 1000 sq ft approx. storage
 68. 1000 sq ft approx. storage
 69. 1000 sq ft approx. storage
 70. 1000 sq ft approx. storage
 71. 1000 sq ft approx. storage
 72. 1000 sq ft approx. storage
 73. 1000 sq ft approx. storage
 74. 1000 sq ft approx. storage
 75. 1000 sq ft approx. storage
 76. 1000 sq ft approx. storage
 77. 1000 sq ft approx. storage
 78. 1000 sq ft approx. storage
 79. 1000 sq ft approx. storage
 80. 1000 sq ft approx. storage
 81. 1000 sq ft approx. storage
 82. 1000 sq ft approx. storage
 83. 1000 sq ft approx. storage
 84. 1000 sq ft approx. storage
 85. 1000 sq ft approx. storage
 86. 1000 sq ft approx. storage
 87. 1000 sq ft approx. storage
 88. 1000 sq ft approx. storage
 89. 1000 sq ft approx. storage
 90. 1000 sq ft approx. storage
 91. 1000 sq ft approx. storage
 92. 1000 sq ft approx. storage
 93. 1000 sq ft approx. storage
 94. 1000 sq ft approx. storage
 95. 1000 sq ft approx. storage
 96. 1000 sq ft approx. storage
 97. 1000 sq ft approx. storage
 98. 1000 sq ft approx. storage
 99. 1000 sq ft approx. storage
 100. 1000 sq ft approx. storage



DAMAGE SURVEY


CLIENT: CRIF WATER OF YEMMOU

STRUCTURE: ACCESS ROAD BRIDGE OVER T-IF UAGUATA RIVER

DATE: 2019/02/06

INSPECTORS: Karama Tawar, Eng.; Sebastian Daigone, Tech.; Simon Laflamme, Tech.

PLAN VIEW VERTICAL AND HORIZONTAL BRACINGS

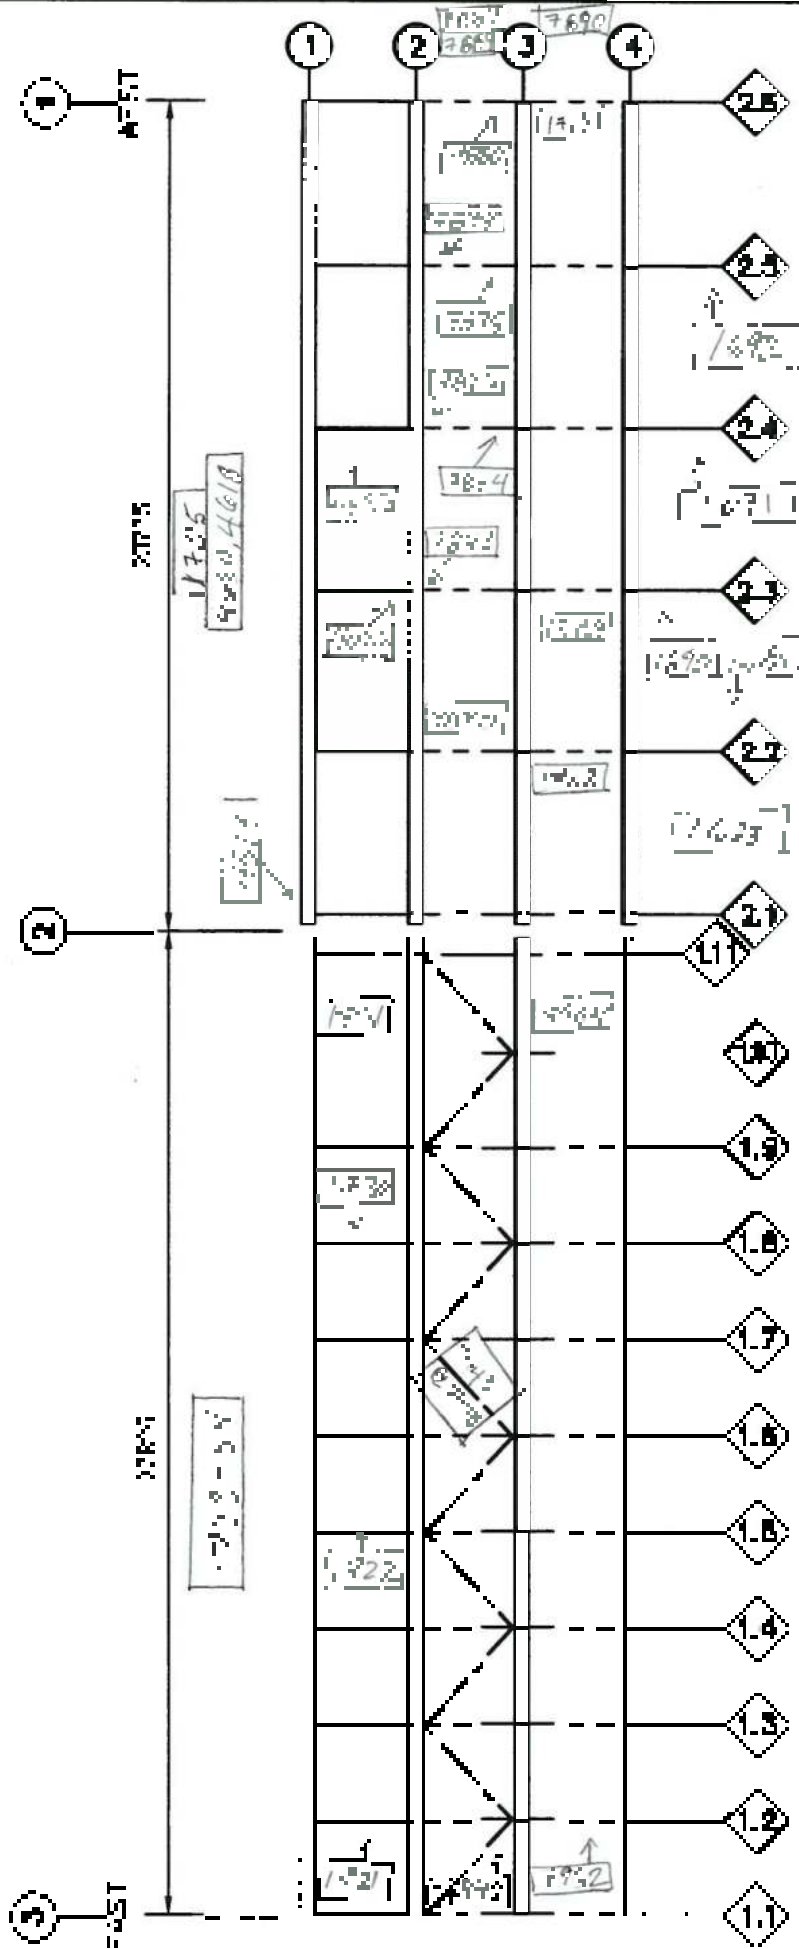

2. Internal bracing
 3. External bracing
 Arrow to see side view

1. Internal bracing
 2. External bracing
 3. External bracing



Stantec

DAMAGE SURVEY


CLIENT: CHIEF PATRON OF AGRIKULTI

STRUCTURE: ACCESS ROAD BRIDGE OVER HE VADUATA RIVER

DATE: 2018/08/06

INSPECTORS: Mr. Umar Fuzri, Mr. Subhan Supriadi, Mr. Sigit Setiawan

SOUTH EVELATION

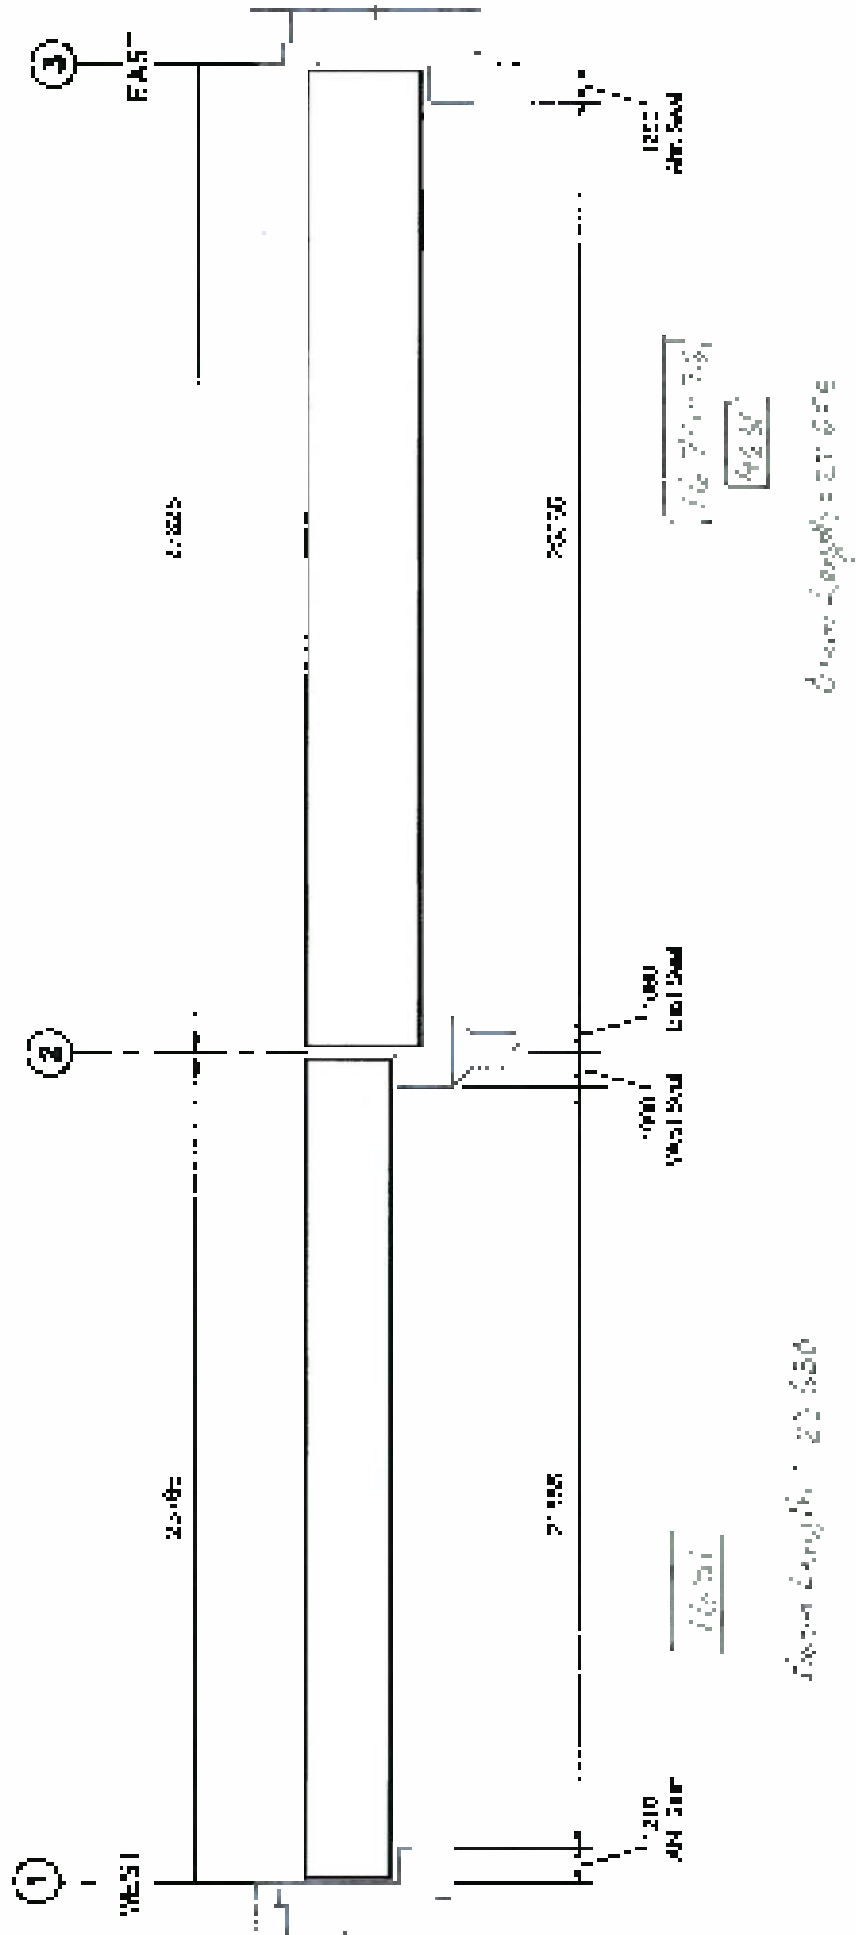

SOUTH EVELATION



Stantec

DAMAGE SURVEY


CLIENT: CREE NATION OF WEAHDAN

SITUATION: ACCESS ROAD BRIDGE OVER THE NAQUATA RIVER

DATE: 2013/08/08

INSPECTORS: Wayne Kramer, eng.; Samuel An Polyzou, lic.; Simon Leblanc, tech.

NORTH EVELATION

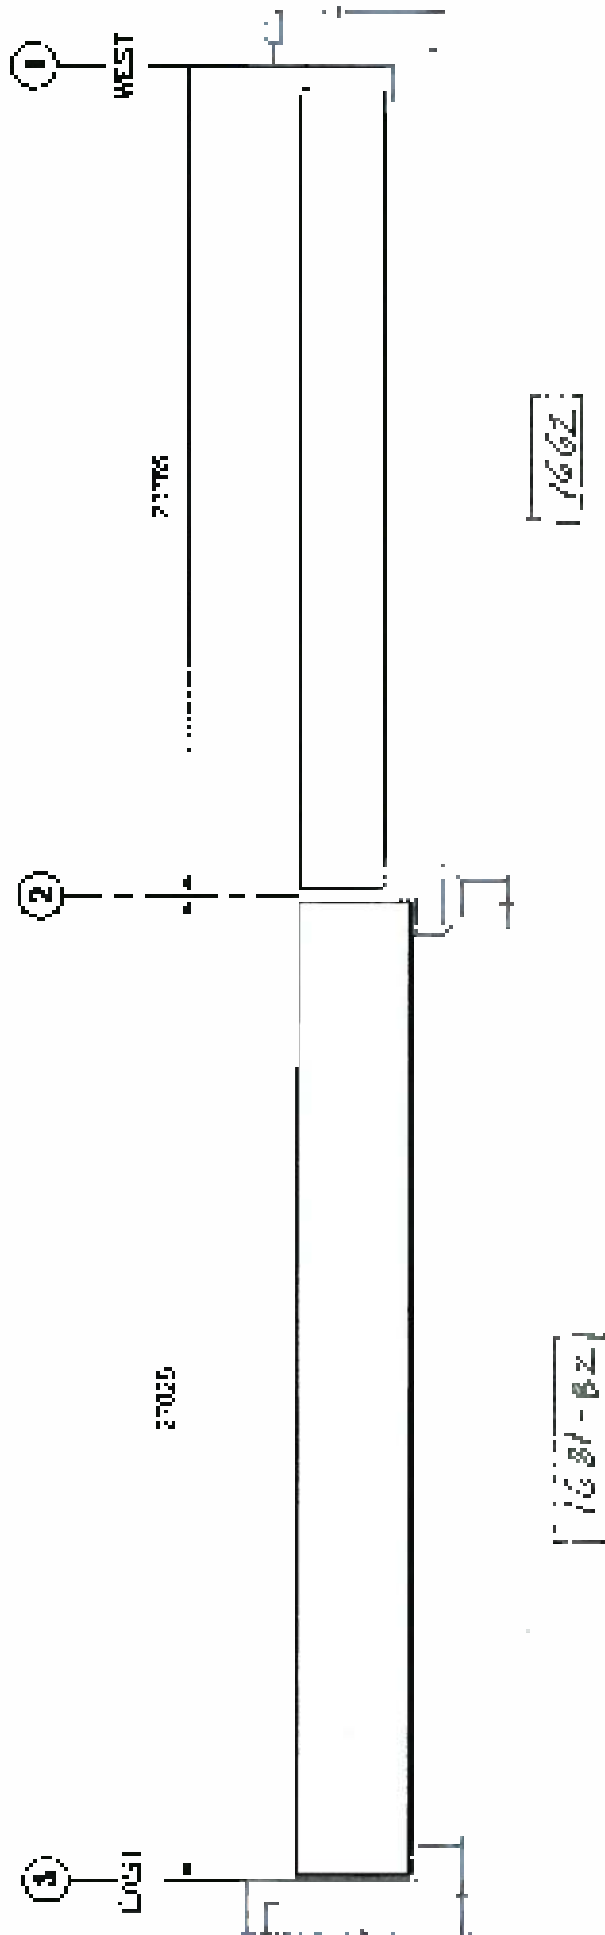

NORTH EVELATION



Stantec

**DAMAGE
SURVEY**


CLIENT: CREE NATION OF WENHOJ

SITUSILHE: ACCESS ROAD BRIDGE OVER THE MANUCCA RIVER

DATE: 22ND AUGUST 2010

INSPECTOR: WYATTO FAULT, CIVIL Structural Engineer Inc. Shyan Lele, P.Eng. 2010

EAST SPAN TYPICAL CROSS-SECTION (H=1600mm)

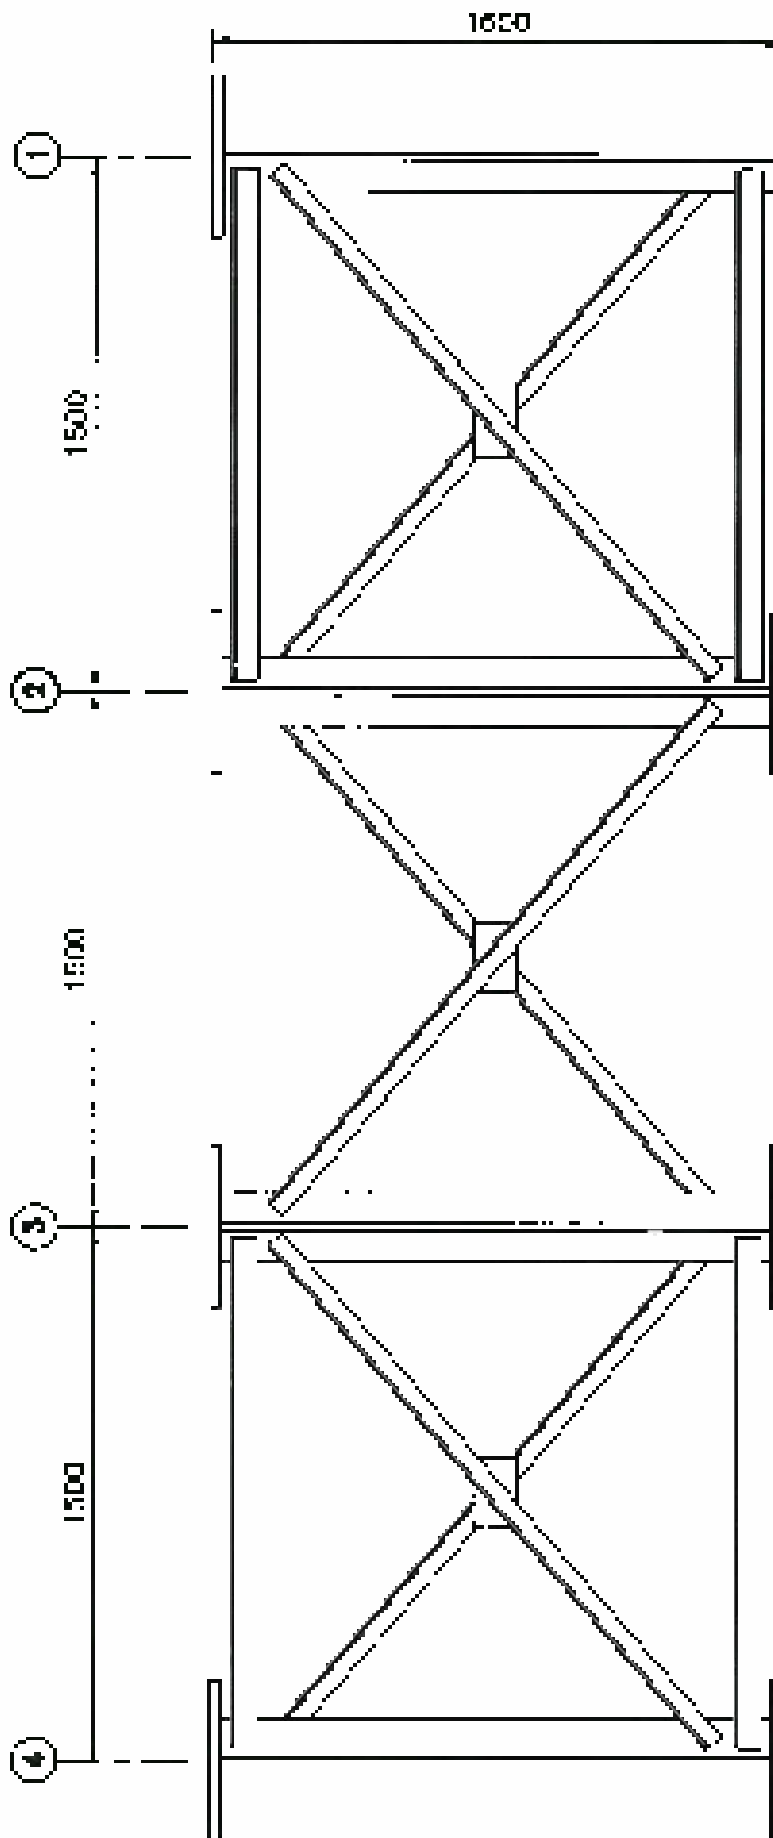

Notes:
Steel Angle (L-shaped): 75 x 75 (190 L)
18 - m mill (7/8")



Stantec

DAMAGE SURVEY


CLIENT: CHIEF PARTN OF MUMUNJI

STRUCTURE: ACCESS ROAD BRIDGE OVER THE PAOLAIA RIVER

DATE: 20/08/2016

INSPECTORS: Wynne L. Brown, eng. + Geraldine Tolgusall, tech. Simon L. Kessing, arch

WEST SPAN TYPICAL CROSS-SECTION (H=1200mm)

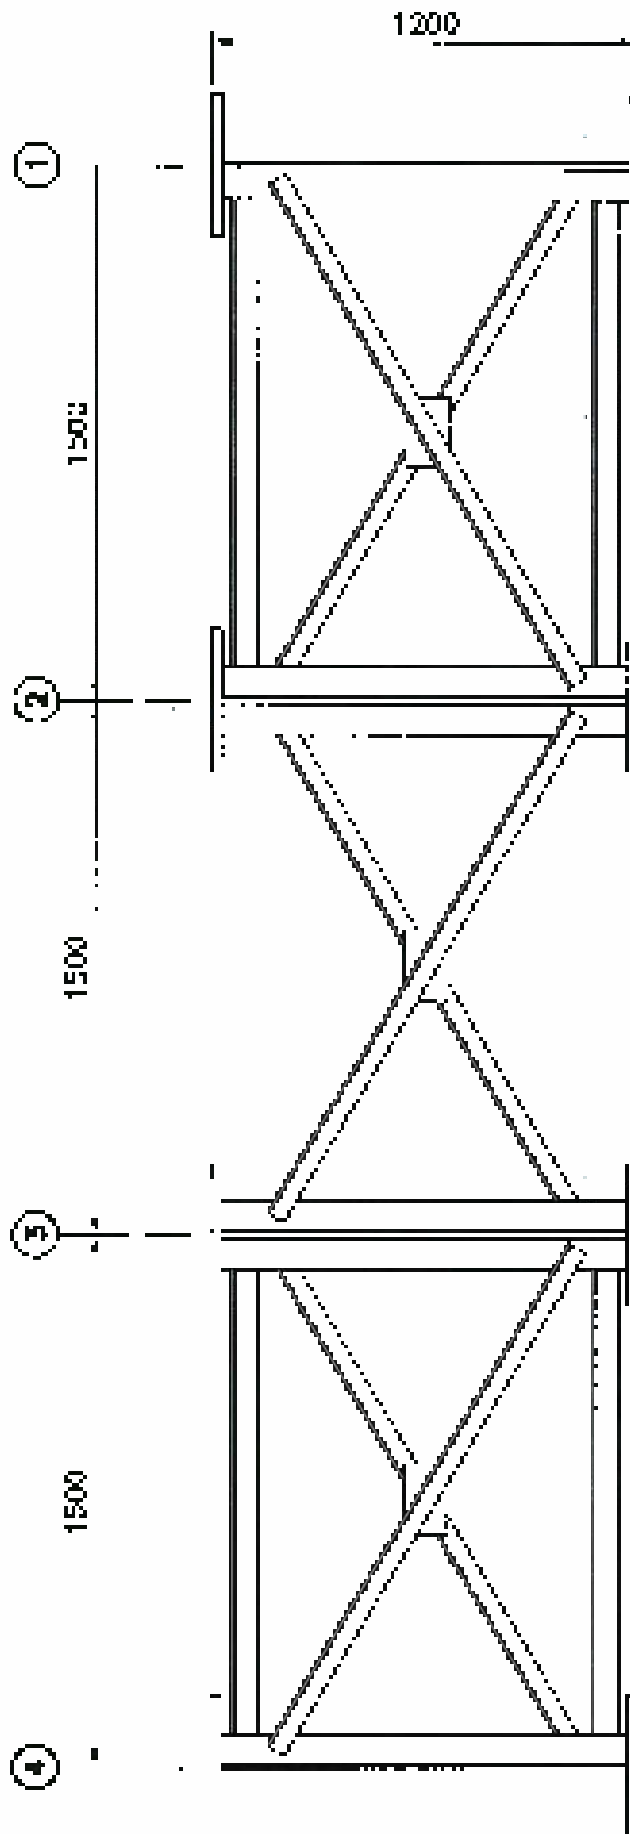

Notes
 1. Steel A-66 (L-shaped) 75 x 75 (Typ.)
 2. 19 mm bolts (Typ.)



DAMAGE SURVEY


CLIENT: GREAT BAYTON OF NIJUNGU

STRUCTURE: ACCESS ROAD BRIDGE OVER THE MADLATA RIVER


DATE: 2010/08/06

INSPECTORS: Nyirama Frank, Eng. Sitoumbe Colynne, K. Tech: Shina J. Lubana, Mr.

WEST ABUTMENT EAST ELEVATION

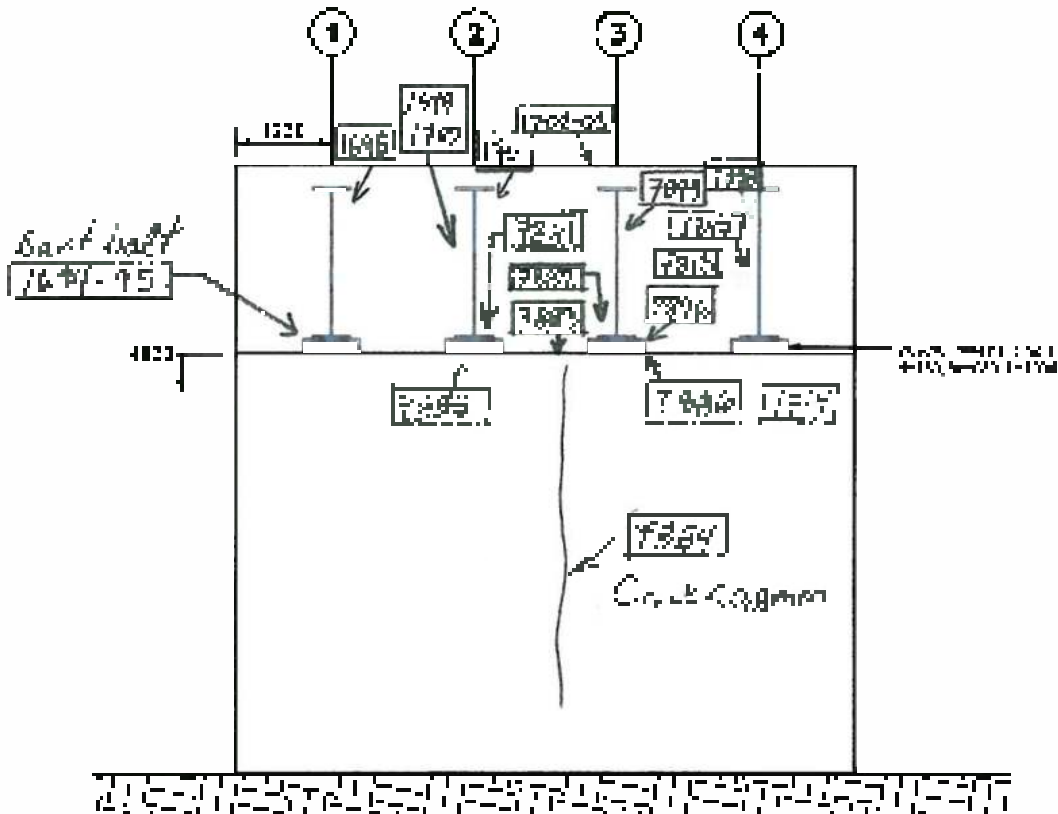

1:20

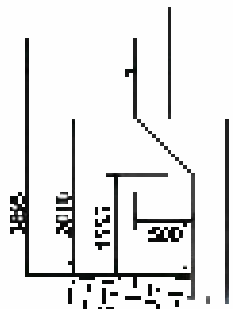

Width (South wall to North wall) = 81.0 mm

Markers

Back wall: 7800

North wall: 7803

Back side of abutment (front wall): 7802

South wall: 7801

Slab: 7804 (G)

CLIENT: GREEN HILL CH OF MOUNTAIN



Stantec

STRUCTURE: ACCESS ROAD BRIDGE OVER THE WONGA RIVER


**DAMAGE
SURVEY**

DATE: 20180818

INSPECTORS: Mylene Frazier (eng.); Scottie de Graaf (tech.); Simon Latham (tech.)

WEST ABUTMENT SOUTH ELEVATION

(SWE 41)

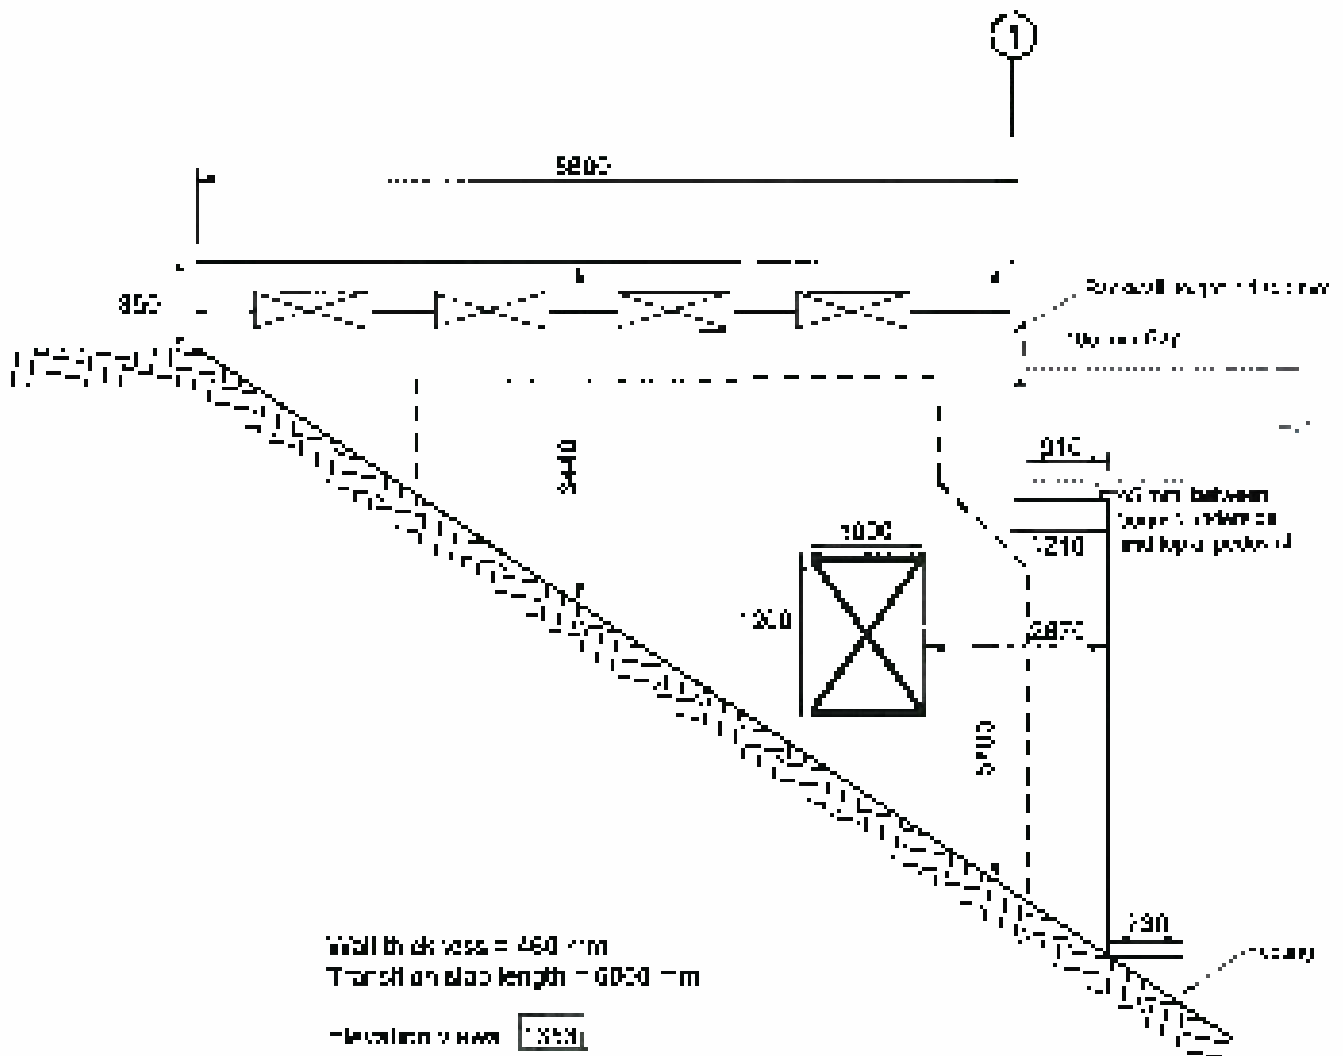



Stantec

CLIENT: GREAT NATION OF YEMHON

STRUCTURE: ACCESS ROAD BRIDGE OVER THE MAQUITA RIVER


**DAMAGE
SURVEY**

DATE: 2/18/2016

INSPECTORS: Myriam Focher, eng., Scottie Douglas, Tech., Simon Lalonde, Tech.

WEST ABUTMENT NORTH ELEVATION

(Wall #2)

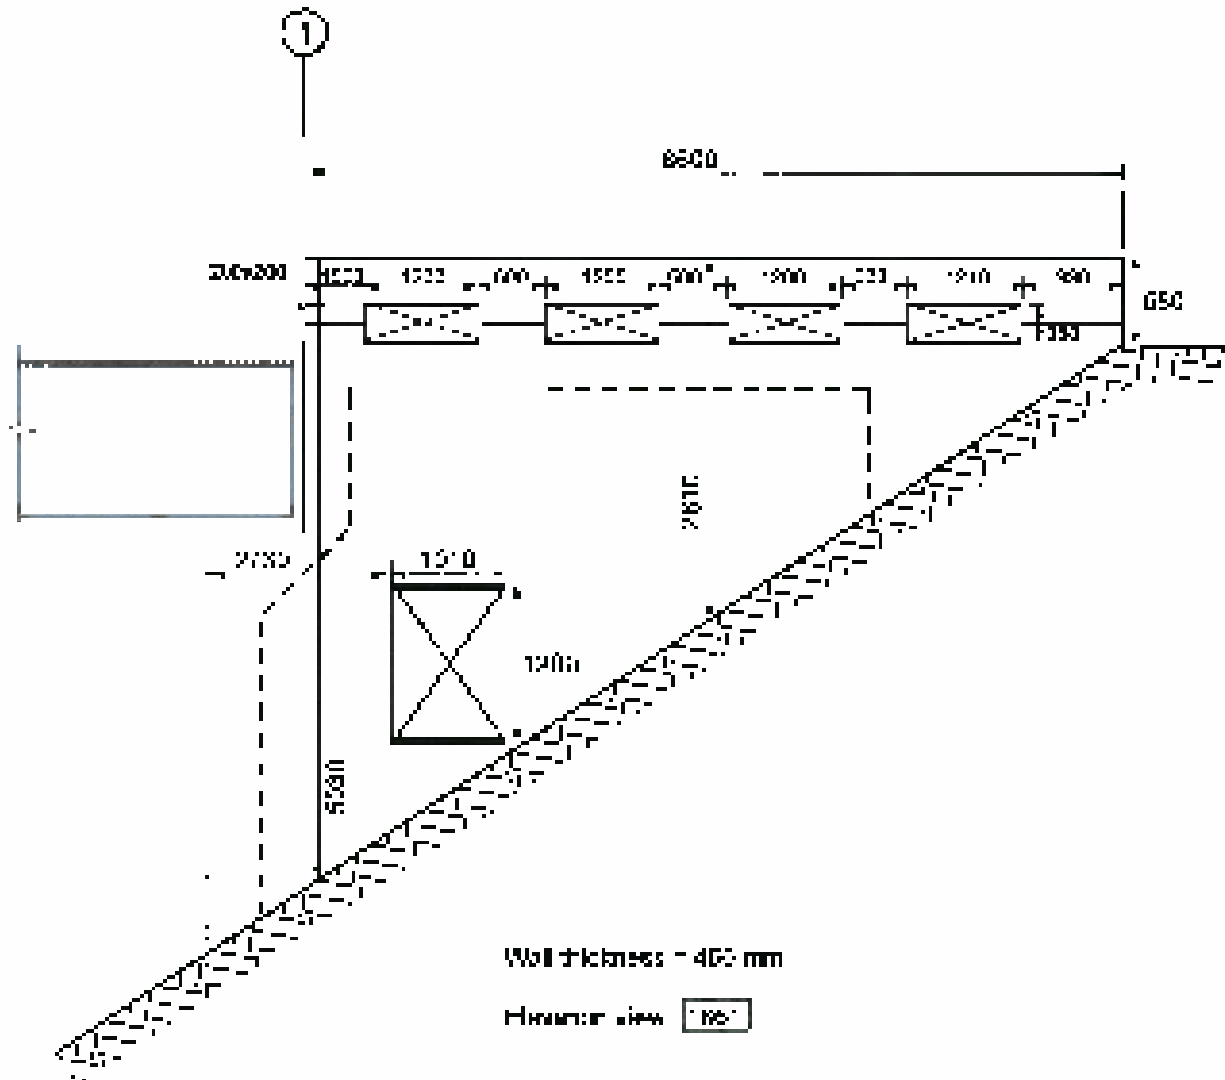



DAMAGE SURVEY


CLIENT: FREE HATCH OF WILMINGTON

PROJECT: ACCESS ROAD BRIDGE OVER THE HAWKATA RIVER

DATE: 22-08-2019

INSPECTORS: Hydraulic Engineer, etc.; Structural Design, etc.; Survey Laboratory, etc.

EAST ABUTMENT WEST ELEVATION

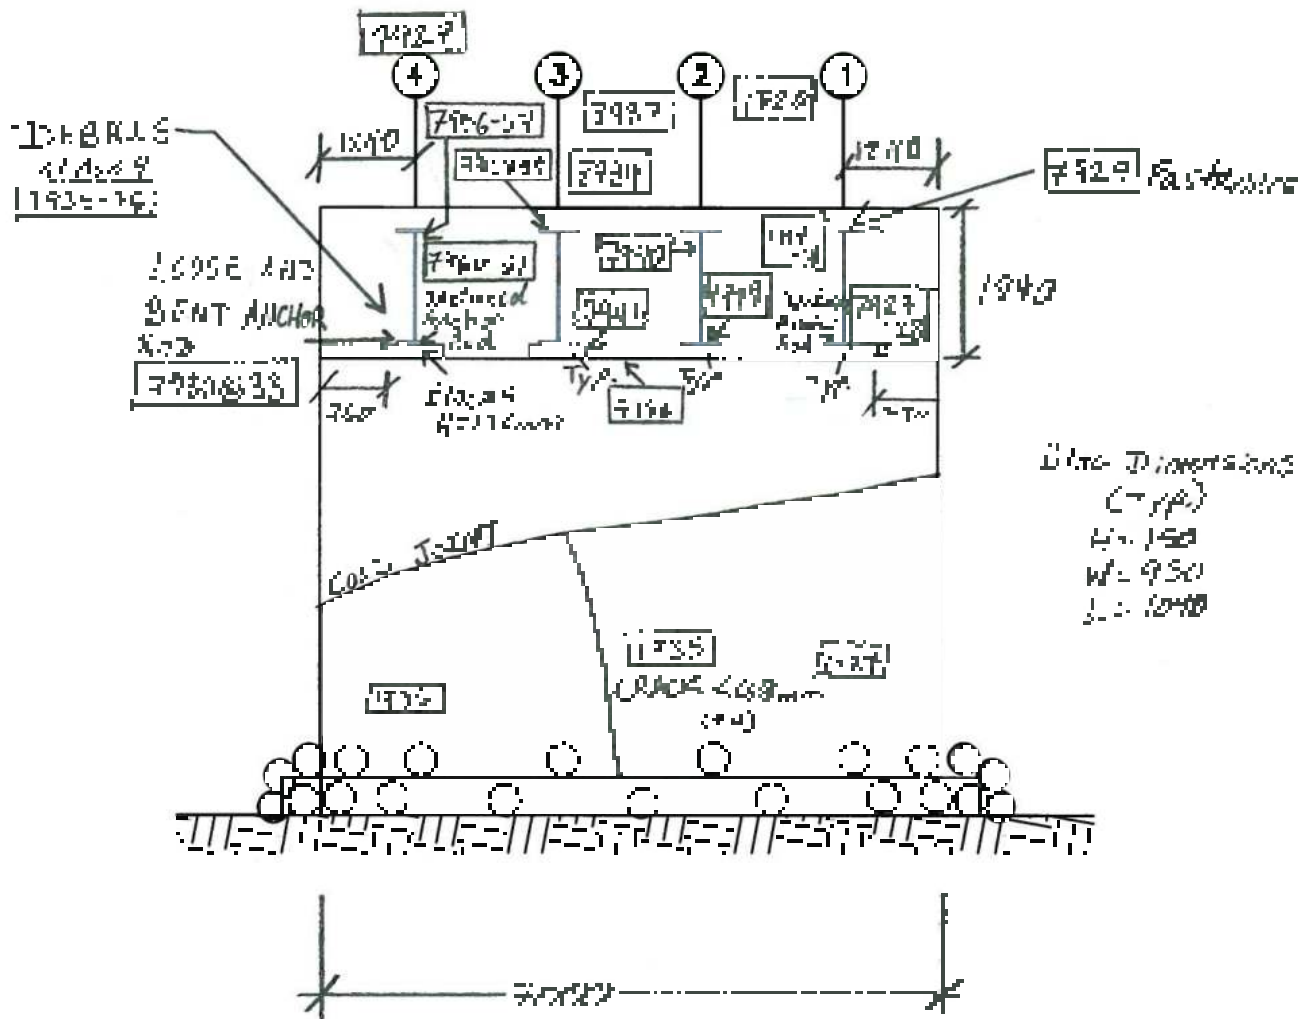

7907

Notes:
 Bar length = 200 mm
 Spacing between the plates and the abutment backwall is 110 mm at Axis 1 and 120 mm at Axis 2.
 Lapped with = 750 mm



Stantec

CLIENT: CREE NATION OF MATHEWA

STRUCTURE: ACCESS ROAD BRIDGE OVER THE MAQUATA RIVER



**DAMAGE
SURVEY**

DATE: 20.08.2018

INSPECTORS: Mr. Mark Farnham, Mr. J. Stewart, Dr. J. Scott, Mr. K. E. Egan, Mr. L. K. Smith, Mr. J. Smith

EAST ABUTMENT SOUTH ELEVATION

(Scale 1:50)

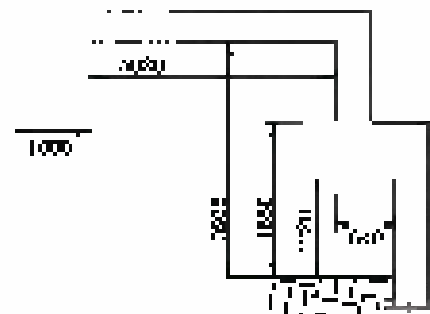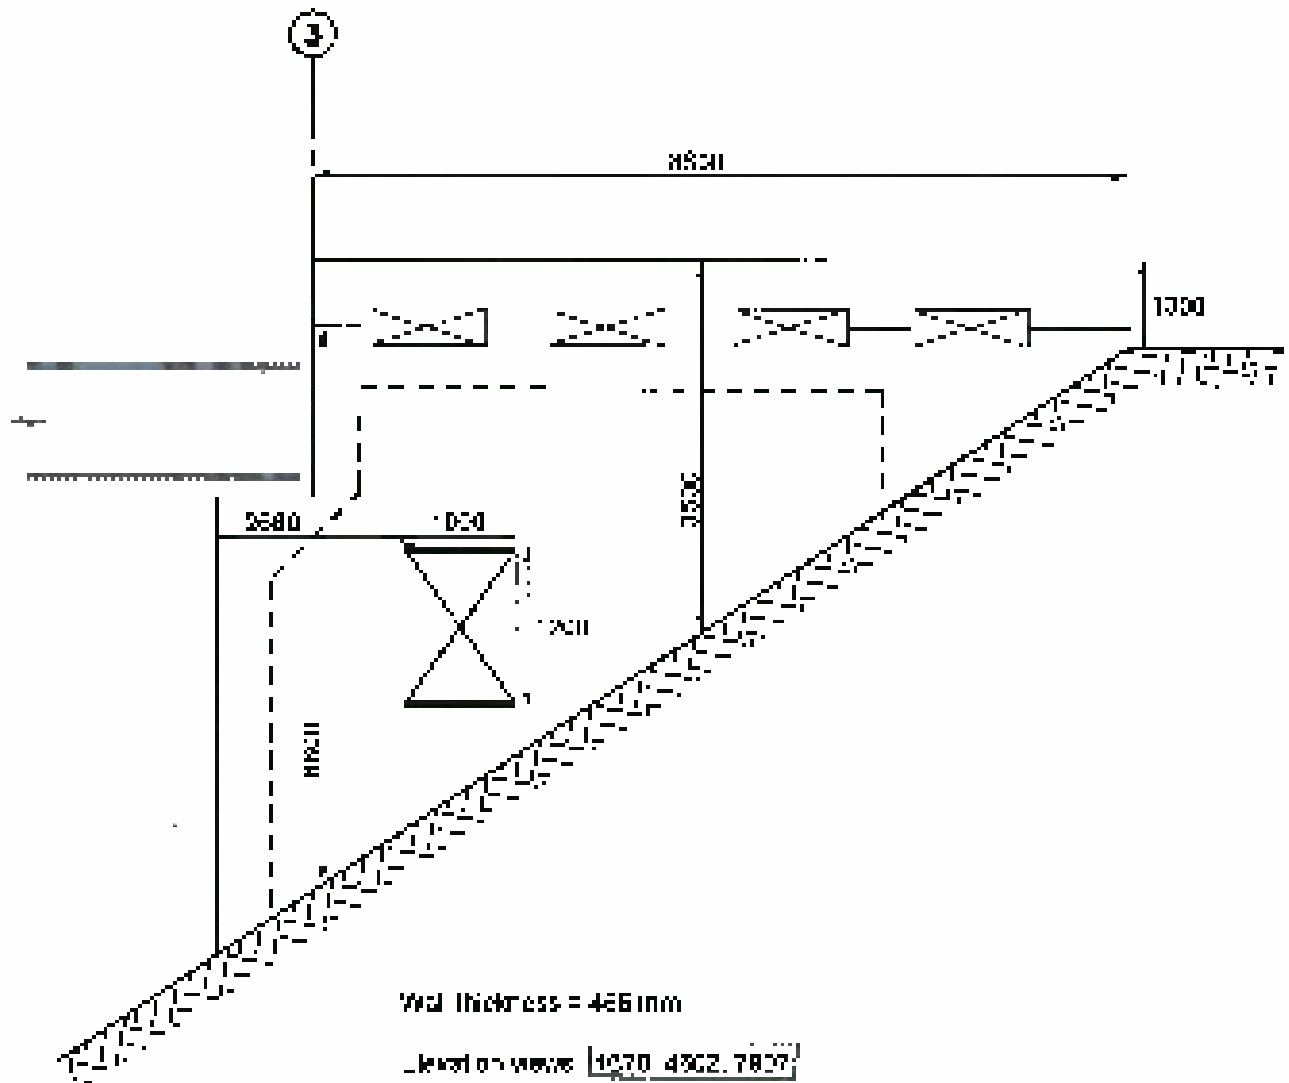

Includes

End wall [7008]

North wall [7500, 5, 7814]

Back side of abutment from wall [7310]

South wall [7814]

Spill [7814-17]



Stantec

CLIENT: CREE NATION OF MICHIGAN

STRUCTURE: ACCESS ROAD BRIDGE OVER THE MAQUATA RIVER


**DAMAGE
SURVEY**

DATE: 25-09-2018


INSPECTORS: Myrona Foyers, P.E., Brandon DeGroot, P.E., Brian Lakowski, Tech

EAST ABUTMENT NORTH ELEVATION

(28/11/18)

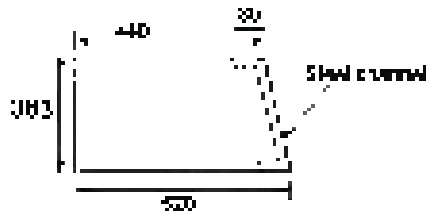

Cross-section A-A

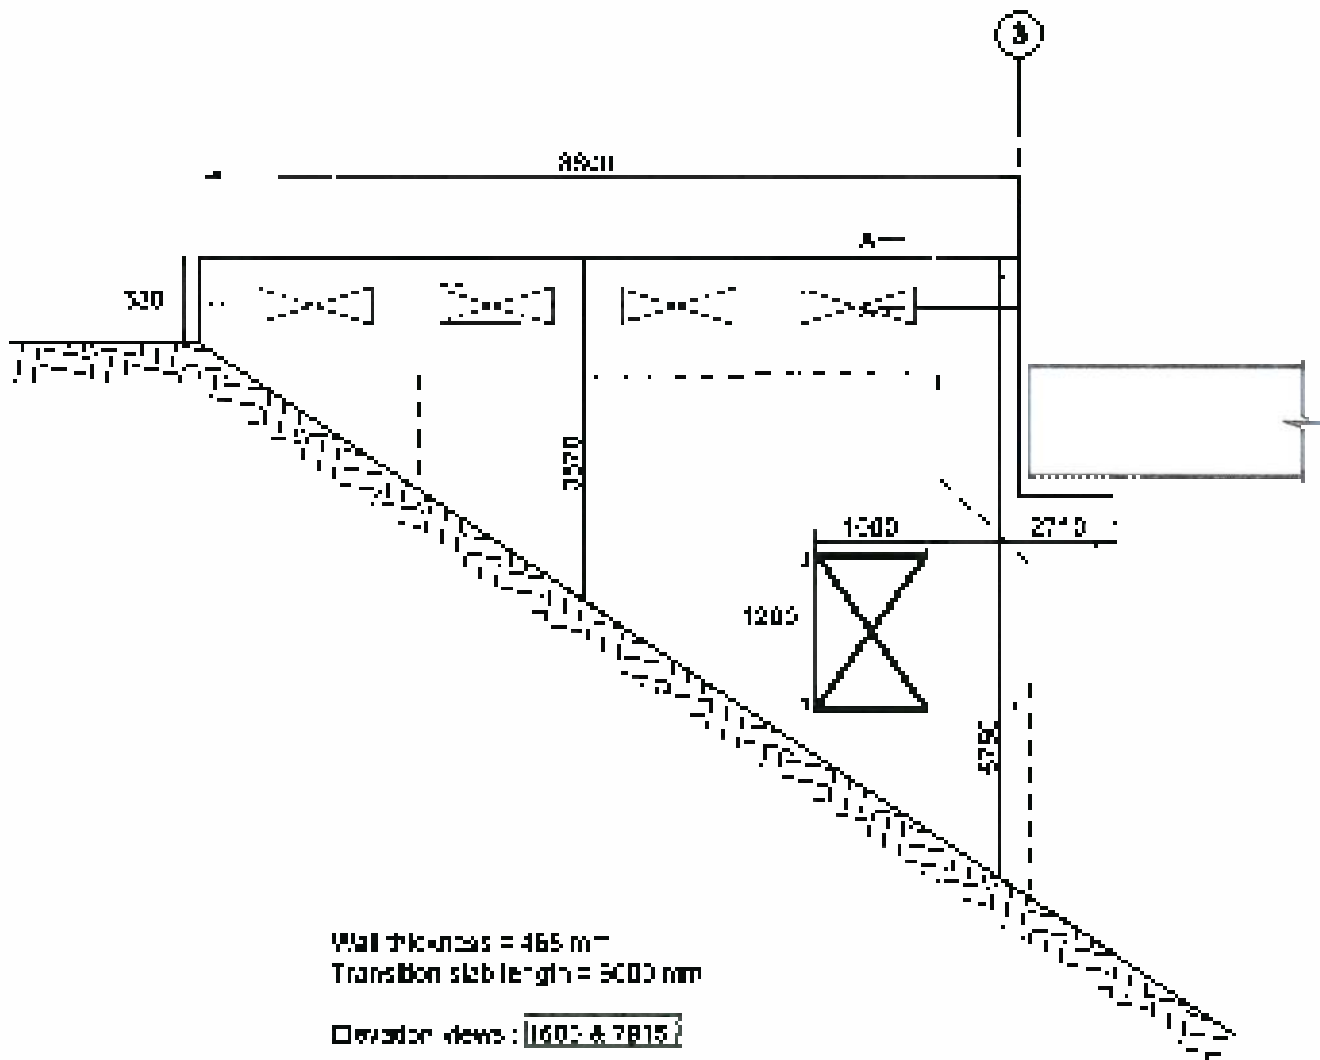



DAMAGE SURVEY


CLIENT: GREE BATCH OF WEDDING

STRUCTURE: ACCESS ROAD BRIDGE OVER THE MAQUINA RIVER

DATE: 2018/08/06

INSPECTORS: He and Fusan, eng. Sebastian Jaramilla Arch. Elmer LeRoux, CCC

PIER (Axis 2) EAST ELEVATION

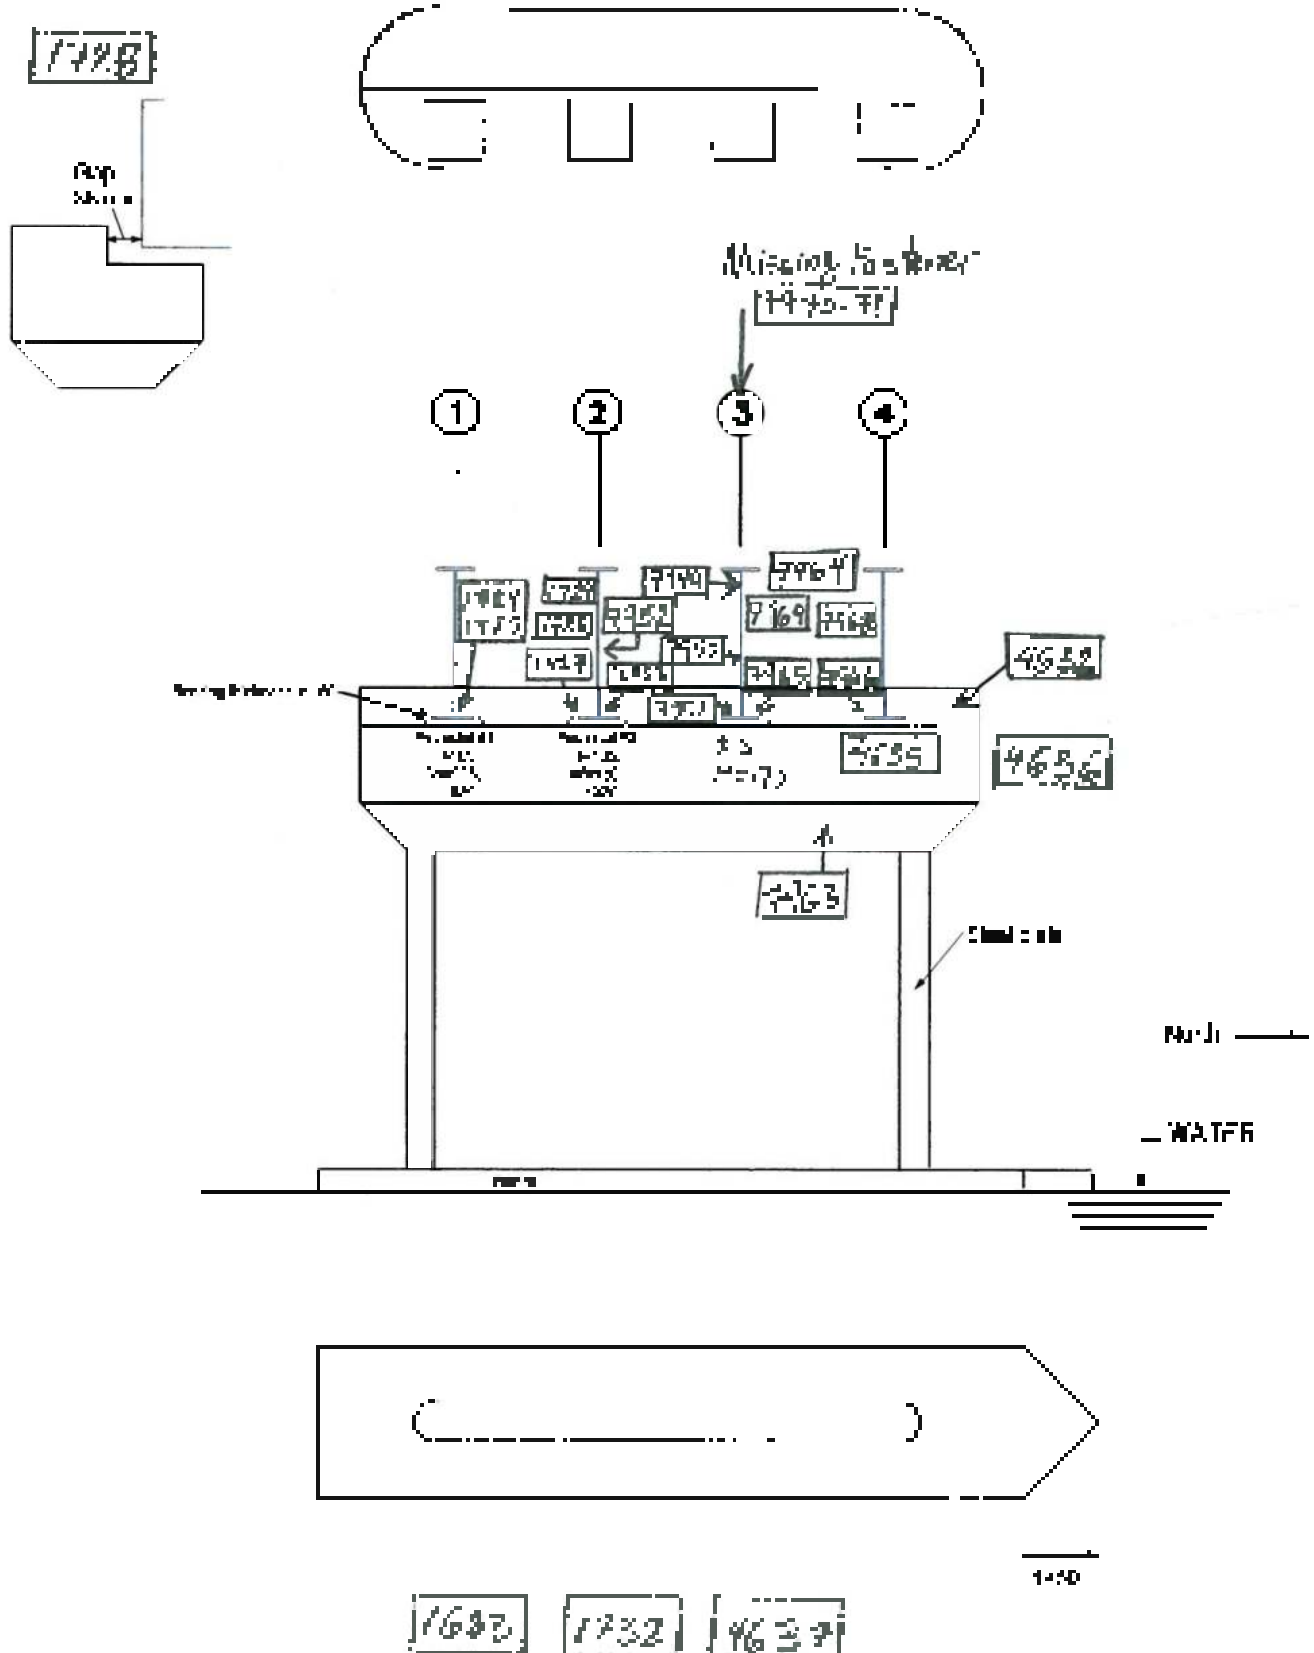




DAMAGE SURVEY


DATE: 2019/05/05

INSPECTORS: Myung-Tae Kim, Sang-Gyeol Cho, Gyeon-Lee Kim, Inchi


**PIER (Axis 2)
WEST ELEVATION**

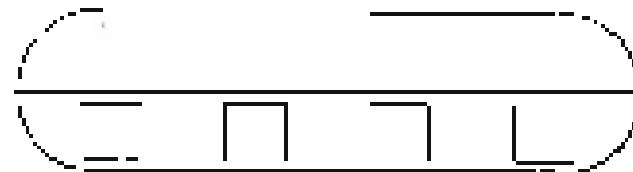

7860-69-69-69-69

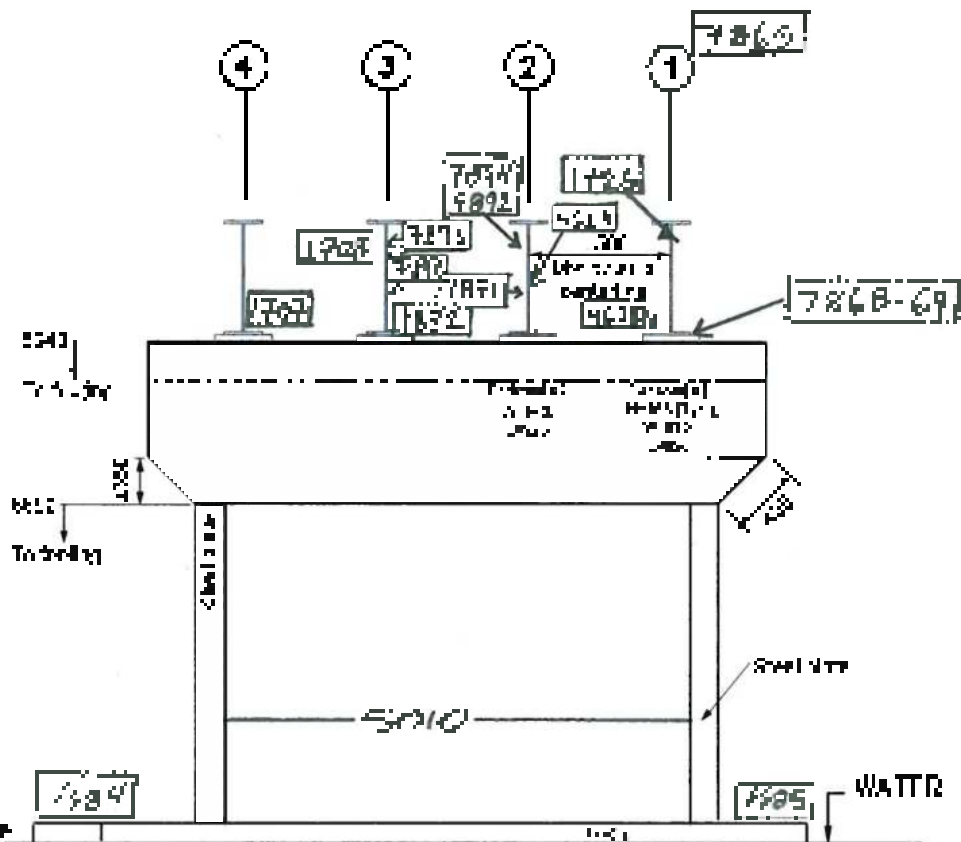

1682 4630 1711-12

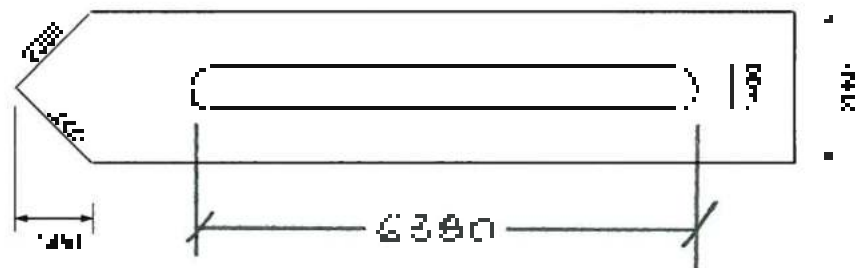

Notes:
 1. Drawing is based on field data. It is intended for reference only.
 2. All dimensions are in millimeters unless otherwise specified.
 3. Overall length: 6380 mm (total length).
 4. Steel plate: 12 mm thick, flange thickness = 12 mm, flange width = 410 mm.



Stantec

CLIENT: DIVISION OF HIGHWAYS


STRUCTURE: ACCESS ROAD BRIDGE OVER THE MAQUATA RIVER

**DAMAGE
SURVEY**

DATE: 2019/08/06

INSPECTORS: Norman Hogg, and Shawn Engler, J. Tech: Simon J. O'Donnell

PIER SOUTH ELEVATION

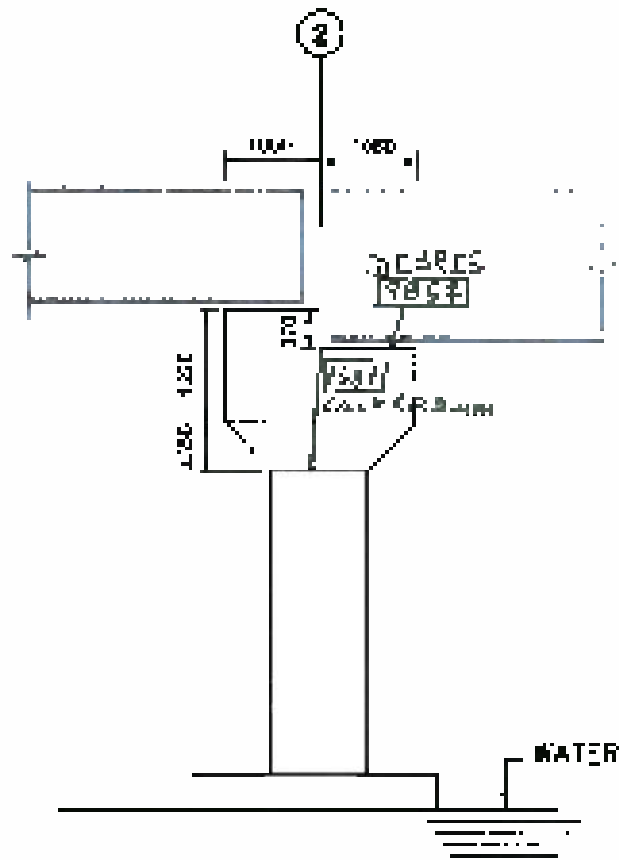

- WEST 1686 EAST ->



Stantec

**DAMAGE
SURVEY**


CLIENT: GREENWATER OF YEMOHAI

STRUCTURE: ACCESS ROAD BRIDGE OVER THE MANGUY RIVER

DATE: 2018/08/08

INSPECTOR: William Brown, Insp.; Richard D. Grayson, Insp.; Simon Lokman, Insp.

PIER NORTH ELEVATION

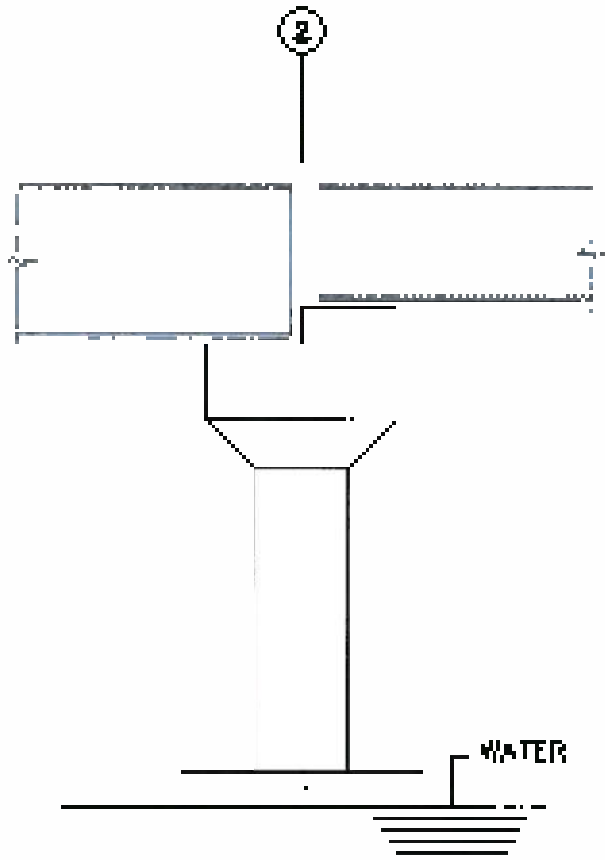

EAST

WEST

APPENDIX C
Photo report



Photo report



Wemindji_4587



Wemindji_4588



Wemindji_4589



Wemindji_4590



Wemindji_4591



Wemindji_4592



Wemindji_4593



Wemindji_1651

Photo report



Wemindji_4594



Wemindji_1653



Wemindji_4595



Wemindji_4596



Wemindji_1654



Wemindji_1655



Wemindji_1656



Wemindji_1657

Photo report



Wemindji_1658



Wemindji_1659



Wemindji_1661



Wemindji_1662



Wemindji_1663



Wemindji_1665



Wemindji_1666



Wemindji_1667

Photo report



Wemindji_1668



Wemindji_1669



Wemindji_1670



Wemindji_1671



Wemindji_1672



Wemindji_1673



Wemindji_1674



Wemindji_1675

Photo report



Wemindji_1676



Wemindji_1678



Wemindji_1680



Wemindji_1681



Wemindji_1682



Wemindji_4597



Wemindji_4598



Wemindji_4599

Photo report



Wemindji_4600



Wemindji_4601



Wemindji_4602



Wemindji_4603



Wemindji_4604



Wemindji_4605



Wemindji_4606



Wemindji_4607

Photo report



Wemindji_4608



Wemindji_4609



Wemindji_4610



Wemindji_4611



Wemindji_4612



Wemindji_4613



Wemindji_4614



Wemindji_4615

Photo report



Wemindji_1683



Wemindji_1684



Wemindji_1685



Wemindji_4616



Wemindji_4617



Wemindji_4618



Wemindji_4619



Wemindji_4620

Photo report



Wemindji_1686



Wemindji_1687



Wemindji_4621



Wemindji_4622



Wemindji_4623



Wemindji_1688



Wemindji_1689



Wemindji_1690

Photo report



Wemindji_7862



Wemindji_7863



Wemindji_1691



Wemindji_1692



Wemindji_4624



Wemindji_4625



Wemindji_4626



Wemindji_4627

Photo report



Wemindji_7864



Wemindji_7865



Wemindji_7866



Wemindji_7867



Wemindji_7868



Wemindji_7869



Wemindji_4628



Wemindji_4629

Photo report



Wemindji_4630



Wemindji_4631



Wemindji_1694



Wemindji_1695



Wemindji_1696



Wemindji_1697



Wemindji_7870



Wemindji_7871

Photo report



Wemindji_7872



Wemindji_7873



Wemindji_7874



Wemindji_7875



Wemindji_7876



Wemindji_7877



Wemindji_7878



Wemindji_7879

Photo report



Wemindji_7880



Wemindji_7881



Wemindji_7882



Wemindji_7883



Wemindji_7884



Wemindji_7885



Wemindji_7886



Wemindji_7887

Photo report



Wemindji_7888



Wemindji_7889



Wemindji_1698



Wemindji_1699



Wemindji_7890



Wemindji_1700



Wemindji_7891



Wemindji_7892

Photo report



Wemindji_1701



Wemindji_1702



Wemindji_1703



Wemindji_7893



Wemindji_7894



Wemindji_1704



Wemindji_1705



Wemindji_1706

Photo report



Wemindji_7895



Wemindji_1707



Wemindji_1708



Wemindji_1709



Wemindji_1710



Wemindji_1711



Wemindji_1712



Wemindji_1713

Photo report



Wemindji_1714



Wemindji_7896



Wemindji_7897



Wemindji_7898



Wemindji_7899



Wemindji_7900



Wemindji_7901



Wemindji_7902

Photo report



Wemindji_7903



Wemindji_7904



Wemindji_7905



Wemindji_7906



Wemindji_7907



Wemindji_7908



Wemindji_7909



Wemindji_7910

Photo report



Wemindji_7911



Wemindji_7912



Wemindji_7913



Wemindji_7914



Wemindji_7915



Wemindji_7916



Wemindji_7917



Wemindji_7918

Photo report



Wemindji_7919



Wemindji_7920



Wemindji_7921



Wemindji_7922



Wemindji_7923



Wemindji_7924



Wemindji_7925



Wemindji_7926

Photo report



Wemindji_7927



Wemindji_7928



Wemindji_7929



Wemindji_4632



Wemindji_4633



Wemindji_4634



Wemindji_4635



Wemindji_4636

Photo report



Wemindji_4637



Wemindji_7930



Wemindji_7931



Wemindji_7932



Wemindji_7934



Wemindji_7935



Wemindji_7936



Wemindji_1715

Photo report



Wemindji_1716



Wemindji_1717



Wemindji_1718



Wemindji_1719



Wemindji_7937



Wemindji_1720



Wemindji_7938



Wemindji_1721

Photo report



Wemindji_7939



Wemindji_7940



Wemindji_7941



Wemindji_7942



Wemindji_1722



Wemindji_7943



Wemindji_7944



Wemindji_7945

Photo report



Wemindji_7946



Wemindji_7947



Wemindji_7948



Wemindji_1724



Wemindji_1725



Wemindji_1726



Wemindji_1727



Wemindji_1728

Photo report



Wemindji_7949



Wemindji_7950



Wemindji_7951



Wemindji_7952



Wemindji_7953



Wemindji_1729



Wemindji_7954



Wemindji_1730

Photo report



Wemindji_1731



Wemindji_1732



Wemindji_1733



Wemindji_1734



Wemindji_1735



Wemindji_1736



Wemindji_1737



Wemindji_7955

Photo report



Wemindji_7956



Wemindji_7957



Wemindji_7958



Wemindji_7959



Wemindji_7960



Wemindji_7961



Wemindji_7962



Wemindji_1738

Photo report



Wemindji_1739



Wemindji_1740



Wemindji_1741



Wemindji_1742



Wemindji_1743



Wemindji_1744



Wemindji_1745



Wemindji_1746

Photo report



Wemindji_1747



Wemindji_1748



Wemindji_1749



Wemindji_1750



Wemindji_1751



Wemindji_1752



Wemindji_7963



Wemindji_7964

Photo report



Wemindji_1753



Wemindji_1754



Wemindji_1755



Wemindji_1756



Wemindji_1757



Wemindji_7965



Wemindji_7966



Wemindji_7967

Photo report



Wemindji_7968



Wemindji_7969



Wemindji_7970



Wemindji_7971



Design with community in mind



CREE
DEVELOPMENT
CORPORATION

Respect · Collaboration · Strength

ᠮᠡᠨᠡᠵᠡᠰᠡᠭᠡᠨᠠᠨᠢᠵᠢᠭᠠᠨᠠᠨᠤᠯᠤᠰ

ᠶᠢᠨᠡᠵᠡᠰᠡᠭᠡᠨᠠᠨᠢᠵᠢᠭᠠᠨᠠᠨᠤᠯᠤᠰ